



**Night School 27:
Fundamentals of
Welding and Bolting**

Thank you for joining our live webinar. We will begin shortly. Please standby.

**AISC
Night School**



Session 4 – Problems and Fixes
October 25, 2021 | Duane K. Miller




**Smarter.
Stronger.
Steel.**

**AISC
Night School**

Today's audio will be broadcast through the internet. Please be sure to turn up the volume on your speakers.

Please type any questions or comments in the Q&A window.




**AISC
Night School**

Today's live webinar will begin shortly. Please stand by.

Today's audio will be broadcast through the internet. Please be sure to turn up the volume on your speakers.

Please type any questions or comments in the Q&A window.




**AISC
Night School**

AIA Credit

AISC is a Registered Provider with The American Institute of Architects Continuing Education Systems (AIA/CES). Credit(s) earned on completion of this program will be reported to AIA/CES for AIA members. Certificates of Completion for both AIA members and non-AIA members are available upon request.

This program has been submitted for AIA/CES for continuing professional education. As such, it does not include content that may be deemed or construed to be an approval or endorsement by the AIA of any material or product.

Questions related to specific materials, methods, and services will be addressed at the conclusion of this presentation.




**AISC
Night School**

Copyright Materials

This presentation is protected by US and International Copyright laws. Reproduction, distribution, display and use of the presentation without written permission of AISC is prohibited.

© The American Institute of Steel Construction 2021

The information presented herein is based on recognized engineering principles and is for general information only. While it is believed to be accurate, this information should not be applied to any specific application without competent professional examination and verification by a licensed professional engineer. Anyone making use of this information assumes all liability arising from such use.




**AISC
Night School**

Course Description

**Problems and Fixes
October 25, 2021**


This session covers problems associated with structural steel construction and provides solutions to many issues. Topics such as repairs to base metal, out-of-tolerance weld joints, repairs to welds, welding on anchor rods including extending rods that are too short, repairing lamellar tears and more are addressed in this session. In all cases, the session provides practical solutions to these common problems.



AISC Night School

Learning Objectives

- Describe all considerations for making repairs to base metal.
- List weldability concerns with extending anchor rods.
- Describe tolerance issues that may affect welded joints.
- Describe how to address a weld performed without proper inspection.



Night School 27: Fundamentals of Welding and Bolting



Curtis L. Decker, PhD, PE, SE, The Lincoln Electric Company



Duane K. Miller, PE, ScD, The Lincoln Electric Company




Chad Larson, LeJeune Bolt Company




Smarter. Stronger. Steel.

Night School 27: Fundamentals of Welding and Bolting
Welding Part 4: Problems and Fixes
October 25, 2021
Duane K. Miller, PE, ScD, The Lincoln Electric Company





LINCOLN ELECTRIC



Smarter. Stronger. Steel.


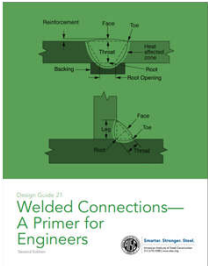
PROBLEMS AND FIXES



10

AISC Design Guide 21, 2nd Edition
Welded Connections – A Primer for Engineers


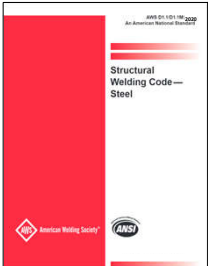
Chapter 15: Problems and Fixes



11



AWS D1.1
Structural Welding Code – Steel

“...with the approval of the Engineer...”
“...when approved by the Engineer...”
“...Engineer approval shall be required...”
“...discretion of the Engineer...”




AWS D1.1:2020 Structural Welding Code--Steel

7.25.3 Engineer's Approval.
Prior approval of the Engineer shall be obtained for repairs to base metal (other than those required by 7.14), repair of major or delayed cracks, repairs to ESW and EGW with internal defects, or for a revised design to compensate for deficiencies. The Engineer shall be notified before welded members are cut apart.

13

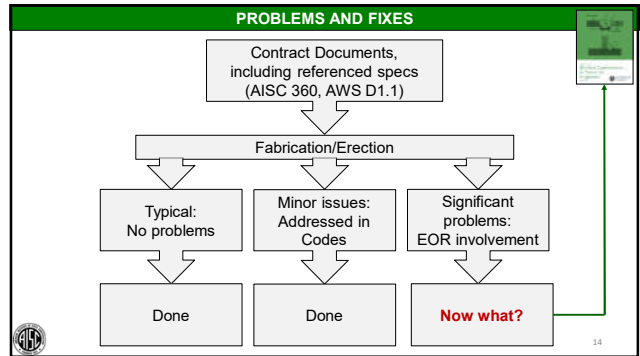

PROBLEMS AND FIXES

Chapter 15: Problems and Fixes

- 15.1 Repairs to Base Metal
- 15.2 Repairs to Cut Edges
- 15.3 Butt Joint Alignment
- 15.4 Out-of-Tolerance Weld Joints
- 15.5 Fixing Members that are Cut Short
- 15.6 Repair of Mislocated Holes
- 15.7 Use of Plug Welds in Lieu of Bolts
- 15.8 Repairs to Welds




15

PROBLEMS AND FIXES

Chapter 15: Problems and Fixes

- 15.9 Heat Shrinking of Q&T Steel
- 15.10 Unspecified Welds
- 15.11 Welds Made Without Inspection
- 15.12 Welding on Anchor Rods
- 15.13 Welding Anchor Rod-to-Base Plates
- 15.14 Removing and Reinstalling Column Base Plates
- 15.15 Repairing Lamellar Tears




16

PROBLEMS AND FIXES

Chapter 15: Problems and Fixes

➔ 15.1 Repairs to Base Metal



- 15.2 Repairs to Cut Edges
- 15.3 Butt Joint Alignment
- 15.4 Out-of-Tolerance Weld Joints
- 15.5 Fixing Members that are Cut Short
- 15.6 Repair of Mislocated Holes
- 15.7 Use of Plug Welds in Lieu of Bolts
- 15.8 Repairs to Welds





17

AWS D1.1:2020 Structural Welding Code--Steel

7.25.3 Engineer's Approval.
Prior approval of the Engineer shall be obtained for repairs to base metal (other than those required by 7.14), repair of major or delayed cracks, repairs to ESW and EGW with internal defects, or for a revised design to compensate for deficiencies. The Engineer shall be notified before welded members are cut apart.

18

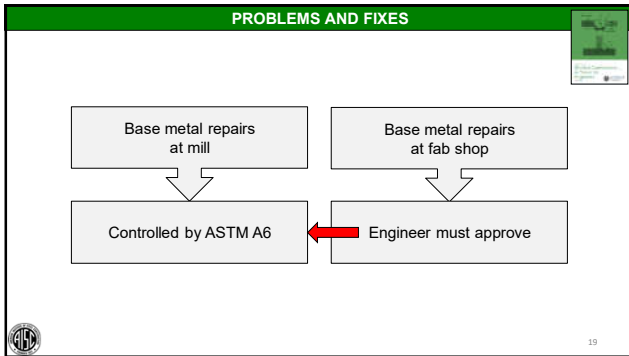

PROBLEMS AND FIXES

15.1.2 Repair of Mill-Induced Discontinuities

Table 15-1. Limits on Imperfection Repaired by Grinding

Material Thickness, in. (mm)	Maximum Removal Depth, in. (mm)
< 3/8 (10)	1/32 (1)
3/8 (10) – 2 (50)	1/16 (2)
> 2 (50)	1/8 (3)

This table was adapted from ASTM A6, Section 9.2.

PROBLEMS AND FIXES


15.1.2 Repair of Mill-Induced Discontinuities

Table 15-1. Limits on Imperfection Repaired by Grinding

Material Thickness, in. (mm)	Maximum Removal Depth, in. (mm)
< 3/8 (10)	1/32 (1)
3/8 (10) – 2 (50)	1/16 (2)
> 2 (50)	1/8 (3)

This table was adapted from ASTM A6, Section 9.2.


- ASTM A6 (summary)**
- The total area of ground material must not exceed 2% of the total surface area of that piece.
 - The reduction in thickness by grinding must not exceed 30% of the nominal thickness of the material at the location of the imperfection, nor exceed 1-1/4 in. (31 mm).
 - For defects that require deeper removal depths than those shown in Table 15-1, repair by welding is permitted.

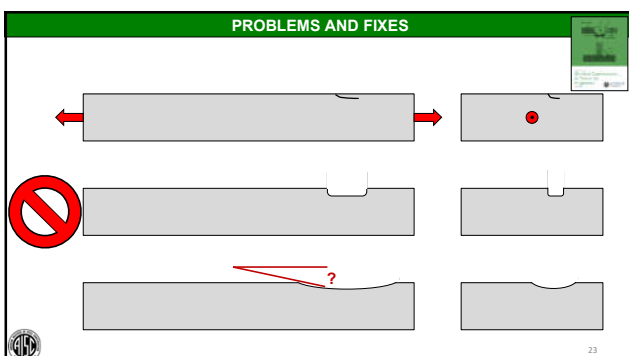

AWS D1.8:2016 Seismic Welding Supplement

6.18.5 Repair of Gouges and Notches.
Gouges and notches in the Protected Zone shall be repaired as follows:

6.18.5.1 Grinding.
When gouges and notches are repaired by grinding, the ground area shall provide a gradual taper to the surface of the base metal. In the direction parallel to the member axis, the taper shall not be greater than 1:5. In the direction transverse to the member axis, the taper shall not be greater than 1:2.5.




25

PROBLEMS AND FIXES

Repairs to Base Metal: Summary

- EOR involvement needed for repairs made in the base metal in the shop, but not in the mill
- DG21 recommendation: apply ASTM A6 criteria to shop repairs
- DG21 recommendation: for slope: D1.8 provides a conservative criteria
- For welded repairs, location of repair should be considered



26

PROBLEMS AND FIXES

Chapter 15: Problems and Fixes

- 15.1 Repairs to Base Metal
- ➔ 15.2 Repairs to Cut Edges
- 15.3 Butt Joint Alignment
- 15.4 Out-of-Tolerance Weld Joints
- 15.5 Fixing Members that are Cut Short
- 15.6 Repair of Mislocated Holes
- 15.7 Use of Plug Welds in Lieu of Bolts
- 15.8 Repairs to Welds



27

PROBLEMS AND FIXES

15.2 Repairs to Cut Edges


- ➔ Repairs to mill-induced discontinuities
- Repairs to contractor-induced discontinuities



28

AWS D1.1:2020 Structural Welding Code--Steel


7.25.3 Engineer's Approval.
Prior approval of the Engineer shall be obtained for repairs to base metal (other than those required by 7.14), repair of major or delayed cracks, repairs to ESW and EGW with internal defects, or for a revised design to compensate for deficiencies. The Engineer shall be notified before welded members are cut apart.



29

AWS D1.1:2020 Structural Welding Code--Steel

7.14.5 Mill-Induced Discontinuities.
The limits of acceptability and the repair of visually observed cut surface discontinuities shall be in conformance with Table 7.4 in which the length of discontinuity is the visible long dimension on the cut surface of material and the depth is the distance that the discontinuity extends into the material from the cut surface. All welded repairs shall be in conformance with this code. Removal of the discontinuity may be done from either surface of the base metal. The aggregate length of welding shall not exceed 20% of the length of the plate surface being repaired except with approval



30

AWS D1.1:2020 Structural Welding Code--Steel

(4) If the area of the discontinuity W, X, Y, or Z exceeds the allowable in 5.14.5.1(2), the cut material or subcomponent shall be rejected and replaced, or repaired **at the discretion of the Engineer.**

31

AWS D1.1:2020 Structural Welding Code--Steel

Figure 7.1—Edge Discontinuities in Cut Material

32

PROBLEMS AND FIXES

33

PROBLEMS AND FIXES

Limits on Acceptability and Repair of Mill Induced Laminar Discontinuities in Cut Surfaces

Discontinuity		Repair
Length (L)	Depth	
≤ 1 in [25 mm]	any	None, need not be explored
> 1 in [25 mm]	$\leq 1/8$ in [3 mm]	None, but determine depth
	$> 1/8$ in [3mm]	Remove, need not weld
	$\leq 1/4$ in [6 mm]	
	$> 1/4$ in [6 mm]	Remove and weld
≤ 1 in [25 mm]	≤ 1 in [25 mm]	See 7.14.5.1
> 1 in [25 mm]	> 1 in [25 mm]	See 7.14.5.1

Adapted from AWS D1.1, Table 7.4.

34

PROBLEMS AND FIXES

Limits on Acceptability and Repair of Mill Induced Laminar Discontinuities in Cut Surfaces

Discontinuity		Repair
Length (L)	Depth	
≤ 1 in [25 mm]	any	None, need not be explored
> 1 in [25 mm]	$\leq 1/8$ in [3 mm]	None, but determine depth
	$> 1/8$ in [3mm]	Remove, need not weld
	$\leq 1/4$ in [6 mm]	
	$> 1/4$ in [6 mm]	Remove and weld
≤ 1 in [25 mm]	≤ 1 in [25 mm]	See 7.14.5.1
> 1 in [25 mm]	> 1 in [25 mm]	See 7.14.5.1

Adapted from AWS D1.1, Table 7.4.

35

PROBLEMS AND FIXES

All are acceptable if the visible dimension is ≤ 1 in. [25 mm].

36

PROBLEMS AND FIXES

Limits on Acceptability and Repair of Mill Induced Laminar Discontinuities in Cut Surfaces		
Discontinuity		Repair
Length (L)	Depth	
≤ 1 in [25 mm]	any	None, need not be explored
> 1 in [25 mm]	≤ 1/8 in [3 mm]	None, but determine depth
	> 1/8 in [3mm]	Remove, need not weld
	≤ 1/4 in [6 mm]	
	>1/4 in [6 mm]	Remove and weld
	≤ 1 in [25 mm]	
> 1 in [25 mm]	See 7.14.5.1	

Adapted from AWS D1.1, Table 7.4.

PROBLEMS AND FIXES

Limits on Acceptability and Repair of Mill Induced Laminar Discontinuities in Cut Surfaces		
Discontinuity		Repair
Length (L)	Depth	
≤ 1 in [25 mm]	any	None, need not be explored
> 1 in [25 mm]	≤ 1/8 in [3 mm]	None, but determine depth
	> 1/8 in [3mm]	Remove, need not weld
	≤ 1/4 in [6 mm]	
	>1/4 in [6 mm]	Remove and weld
	≤ 1 in [25 mm]	
> 1 in [25 mm]	See 7.14.5.1	

Adapted from AWS D1.1, Table 7.4.



PROBLEMS AND FIXES



Limits on Acceptability and Repair of Mill Induced Laminar Discontinuities in Cut Surfaces		
Discontinuity		Repair
Length (L)	Depth	
≤ 1 in [25 mm]	any	None, need not be explored
> 1 in [25 mm]	≤ 1/8 in [3 mm]	None, but determine depth
	> 1/8 in [3mm]	Remove, need not weld
	≤ 1/4 in [6 mm]	
	>1/4 in [6 mm]	Remove and weld
	≤ 1 in [25 mm]	
> 1 in [25 mm]	See 7.14.5.1	

Adapted from AWS D1.1, Table 7.4.

AWS D1.1:2020 Structural Welding Code—Steel

Note to AWS D1.1 Table 7.4:
 A spot check of 10% of the discontinuities on the cut surface in question should be explored by grinding to determine depth. If the depth of any one of the discontinuities explored exceeds 1/8 in [3 mm], then all of the discontinuities over 1 in [25 mm] in length remaining on that cut surface shall be explored by grinding to determine depth. If none of the discontinuities explored in the 10% spot check have a depth exceeding 1/8 in [3 mm], then the remainder of the discontinuities on that cut surface need not be explored.

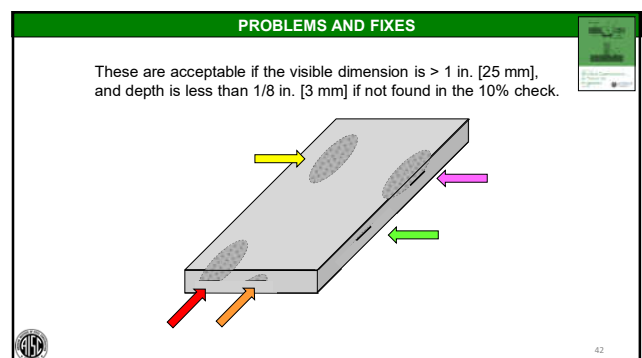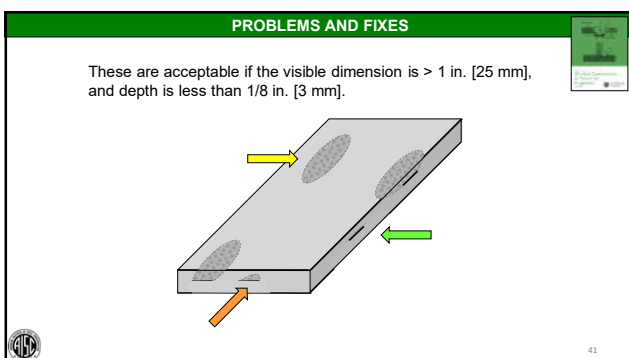


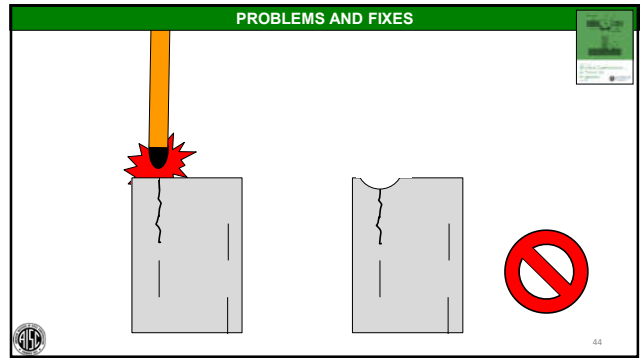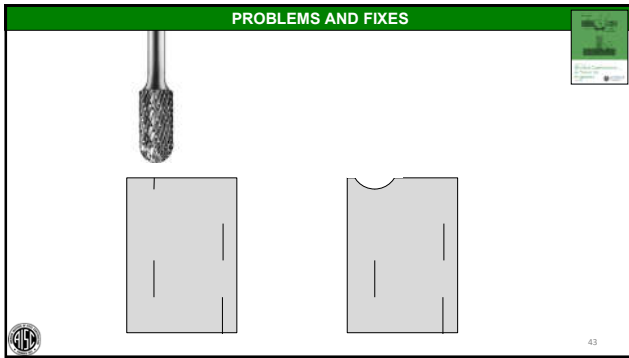

PROBLEMS AND FIXES

Limits on Acceptability and Repair of Mill Induced Laminar Discontinuities in Cut Surfaces		
Discontinuity		Repair
Length (L)	Depth	
≤ 1 in [25 mm]	any	None, need not be explored
> 1 in [25 mm]	≤ 1/8 in [3 mm]	None, but determine depth
	> 1/8 in [3mm] ≤ 1/4 in [6 mm]	Remove, need not weld
	> 1/4 in [6 mm] ≤ 1 in [25 mm]	Remove and weld
	> 1 in [25 mm]	See 7.14.5.1

Adapted from AWS D1.1, Table 7.4.

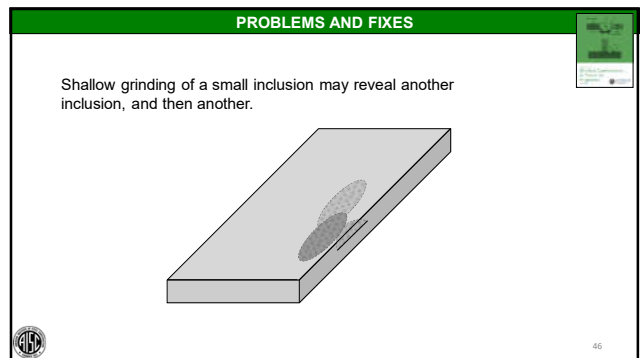

PROBLEMS AND FIXES

Limits on Acceptability and Repair of Mill Induced Laminar Discontinuities in Cut Surfaces		
Discontinuity		Repair
Length (L)	Depth	
≤ 1 in [25 mm]	any	None, need not be explored
> 1 in [25 mm]	≤ 1/8 in [3 mm]	None, but determine depth
	> 1/8 in [3mm] ≤ 1/4 in [6 mm]	Remove, need not weld
	> 1/4 in [6 mm] ≤ 1 in [25 mm]	Remove and weld
	> 1 in [25 mm]	See 7.14.5.1

Adapted from AWS D1.1, Table 7.4.

PROBLEMS AND FIXES


Limits on Acceptability and Repair of Mill Induced Laminar Discontinuities in Cut Surfaces		
Discontinuity		Repair
Length (L)	Depth	
≤ 1 in [25 mm]	any	None, need not be explored
> 1 in [25 mm]	≤ 1/8 in [3 mm]	None, but determine depth
	> 1/8 in [3mm] ≤ 1/4 in [6 mm]	Remove, need not weld
	> 1/4 in [6 mm] ≤ 1 in [25 mm]	Remove and weld
	> 1 in [25 mm]	See 7.14.5.1

Adapted from AWS D1.1, Table 7.4.

AWS D1.1:2020 Structural Welding Code--Steel

7.14.5.1 Acceptance Criteria.
 For discontinuities greater than 1 in [25 mm] in length and depth discovered on cut surfaces, the following procedures shall be observed.

(1) Where discontinuities such as W, X, or Y in Figure 7.1 are observed prior to completing the joint, the size and shape of the discontinuity shall be determined by UT...



49

AWS D1.1:2020 Structural Welding Code--Steel

One purpose of 7.14.5.1 is to find this:

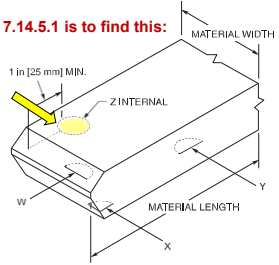




Figure 7.1—Edge Discontinuities in Cut Material



50

AWS D1.1:2020 Structural Welding Code--Steel

(4) If the area of the discontinuity W, X, Y, or Z exceeds the allowable in 7.14.5.1(2), the cut material or subcomponent shall be rejected and replaced, or repaired at the discretion of the Engineer.




51

AWS D1.1:2020 Structural Welding Code--Steel



7.14.5.2 Repair.
 In the repair and determination of limits of mill induced discontinuities visually observed on cut surfaces, the amount of metal removed shall be the minimum necessary to remove the discontinuity or to determine the limits of Table 7.4 are not exceeded. ...

NOTE: The requirements of 7.14.5.2 may not be adequate in cases of tensile load applied through the thickness of the material.



52

PROBLEMS AND FIXES

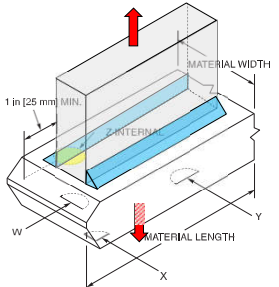



53

PROBLEMS AND FIXES

Repairs to Cut Edges (Mill Induced): Summary

- Length and depth determine acceptability and permitted repairs
- Explore by grinding, not AAG
- Excessive inclusions may render the steel unacceptable



54

PROBLEMS AND FIXES

Chapter 15: Problems and Fixes

- 15.1 Repairs to Base Metal
- 15.2 Repairs to Cut Edges
- ➔ 15.3 Butt Joint Alignment
- 15.4 Out-of-Tolerance Weld Joints
- 15.5 Fixing Members that are Cut Short
- 15.6 Repair of Mislocated Holes
- 15.7 Use of Plug Welds in Lieu of Bolts
- 15.8 Repairs to Welds

55





AWS D1.1:2020 Structural Welding Code--Steel




7.21.3 Butt Joint Alignment.

Parts to be joined at butt joints shall be carefully aligned. Where the parts are effectively restrained against bending due to eccentricity in alignment, the offset from the theoretical alignment shall not exceed 10% of the thickness of the thinner part joined, or 1/8 in [3 mm], whichever is smaller. In correcting misalignment in such cases, the parts shall not be drawn in to a greater slope than 1/2 in [12 mm] in 12 in [300 mm]. Measurement of offset shall be based upon the centerline of parts unless otherwise shown on the drawings.

1/2 in 12 = 1 in 24

56

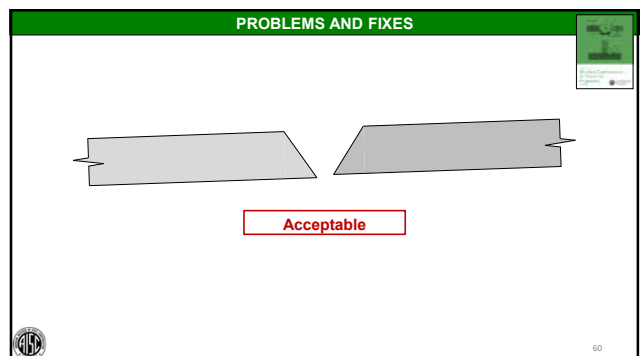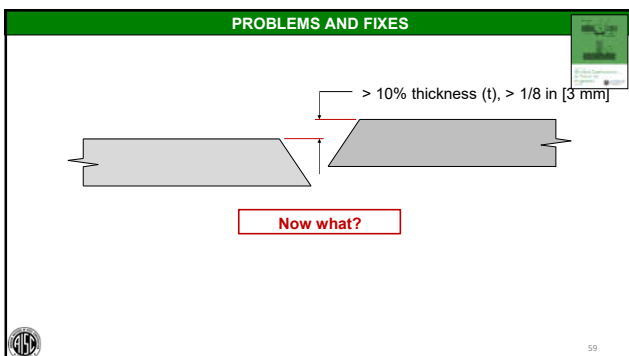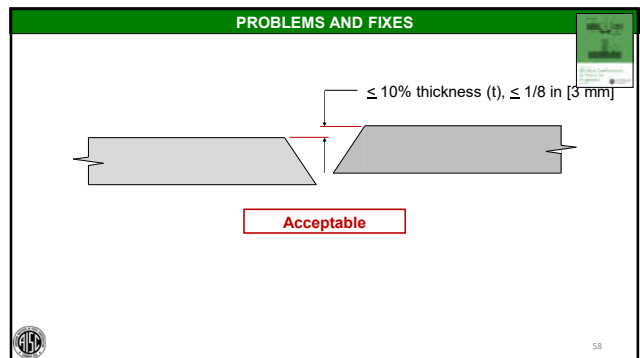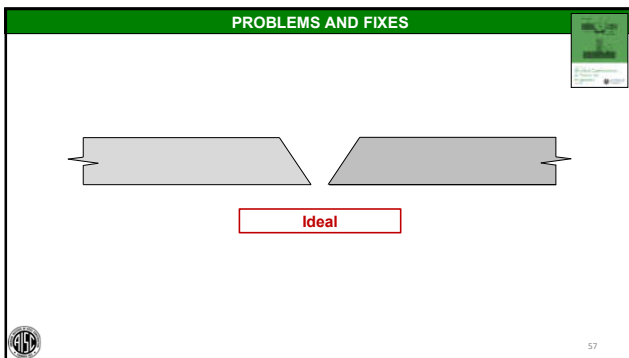

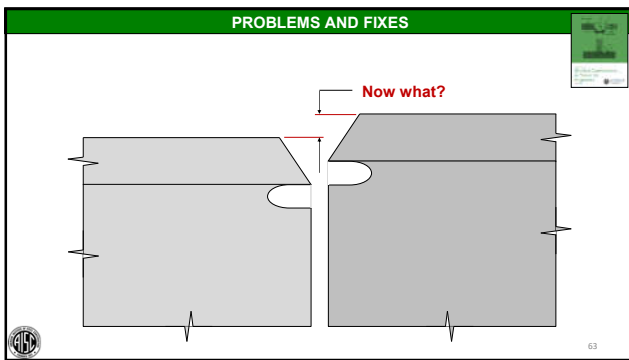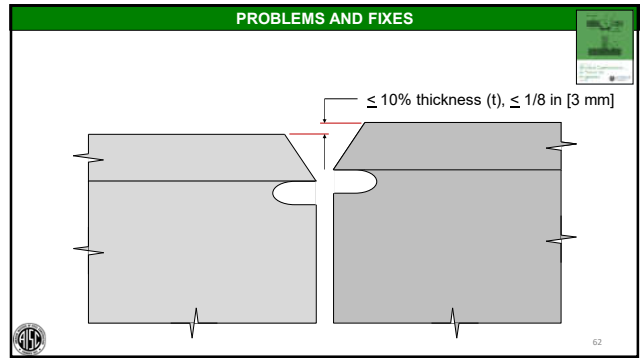
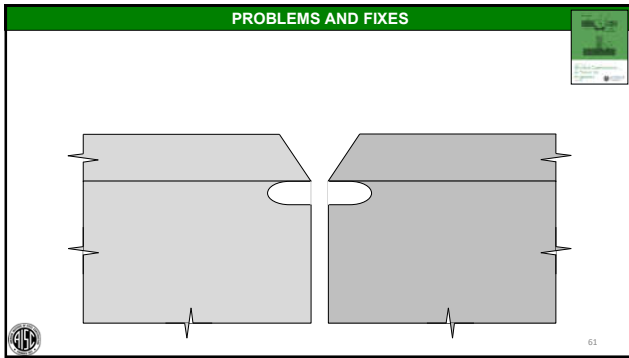





AWS D1.1:2020 Structural Welding Code--Steel

8.8 Engineer's Approval for Alternate Acceptance Criteria

The fundamental premise of the code is to provide general stipulations applicable to most situations. Acceptance criteria for production welds different from those described in the code may be used for a particular application, provided they are suitably documented by the proposer and approved by the Engineer.

These alternate acceptance criteria may be based upon evaluation of suitability for service using past experience, experimental evidence or engineering analysis considering material type, service load effects, and environmental factors.

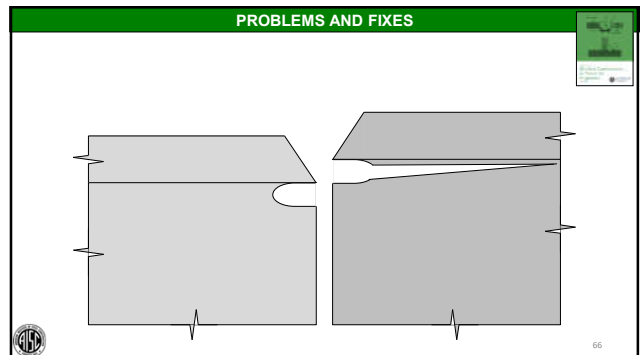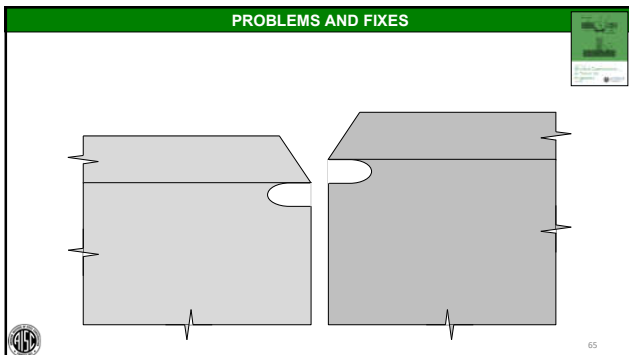

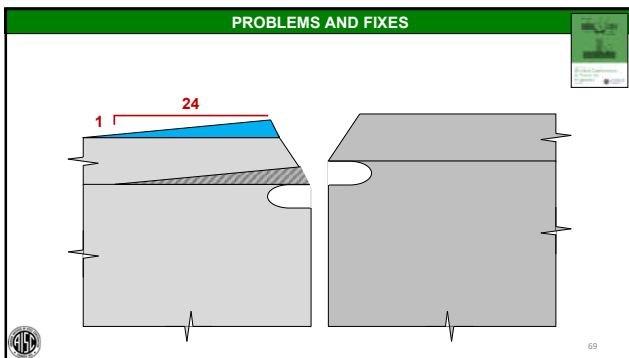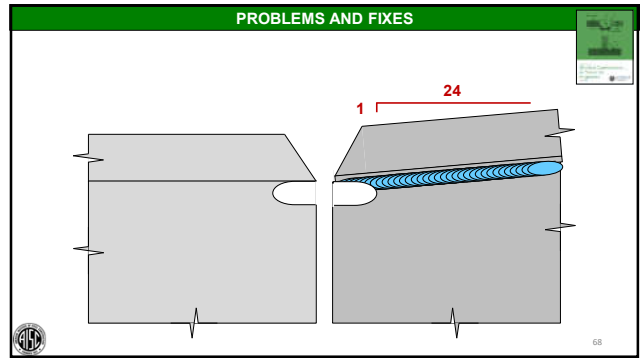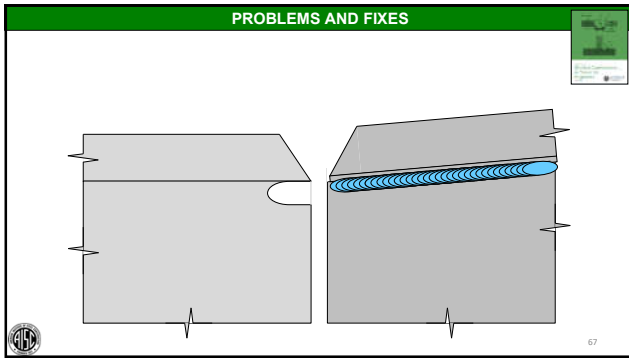

1 in 24 ratio


Offset	Length
1/4 in (6 mm)	6 in (150 mm)
1/2 in (12 mm)	12 in (300 mm)
3/4 in (18 mm)	18 in (450 mm)
1 in (25 mm)	24 in (600 mm)

AWS D1.1:2020 Structural Welding Code--Steel

7.21.3 Butt Joint Alignment.

Parts to be joined at butt joints shall be carefully aligned. Where the parts are effectively restrained against bending due to eccentricity in alignment, **the offset from the theoretical alignment shall not exceed 10% of the thickness of the thinner part joined, or 1/8 in [3 mm], whichever is smaller.** In correcting misalignment in such cases, the parts shall not be drawn in to a greater slope than 1/2 in [12 mm] in 12 in [300 mm]. Measurement of offset shall be based upon the centerline of parts unless otherwise shown on the drawings.

1/2 in 12 = 1 in 24

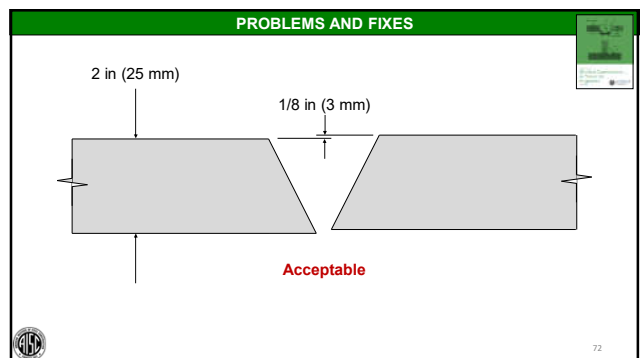

PROBLEMS AND FIXES

Does it matter?

73

PROBLEMS AND FIXES

15.3 Butt Joint Alignment: Summary

- Code provides limits: smaller of 10% thickness or 1/8 in (3 mm)
- For restrained members, 1:24 slope
- EOR could permit alternative criteria

74

PROBLEMS AND FIXES

Chapter 15: Problems and Fixes

- 15.1 Repairs to Base Metal
- 15.2 Repairs to Cut Edges
- 15.3 Butt Joint Alignment
- ➔ 15.4 Out-of-Tolerance Weld Joints
- 15.5 Fixing Members that are Cut Short
- 15.6 Repair of Mislocated Holes
- 15.7 Use of Plug Welds in Lieu of Bolts
- 15.8 Repairs to Welds

75

PROBLEMS AND FIXES

15.4 Out-of-tolerance Weld Joints

- 15.4.1 Sources of Fit-Up Variation
- ➔ 15.4.2 Fit-Up Problems with Fillet Welded Joints
- 15.4.3 Fit-Up Problems with CJP Groove Welded Joints
- 15.4.4 Fit-Up Problems with PJP Groove Welded Joints
- 15.4.5 Fit-Up Problems with Plug and Slot Welded Joints

76

AWS D1.1:2020 Structural Welding Code--Steel

7.21.1 Fillet Weld Assembly.

The parts to be joined by fillet welds shall be brought into as close contact as practicable. The root opening shall not exceed 3/16 in [5 mm] except in cases involving either shapes or plates 3 in [75 mm] or greater in thickness if, after straightening and in assembly, the root opening cannot be closed sufficiently to meet this tolerance...a maximum root opening of 5/16 in [8 mm] may be used, provided suitable backing is used.

77



PROBLEMS AND FIXES

Ideal

Permitted without correction

$\leq 1/16$ in.
[2 mm]

78


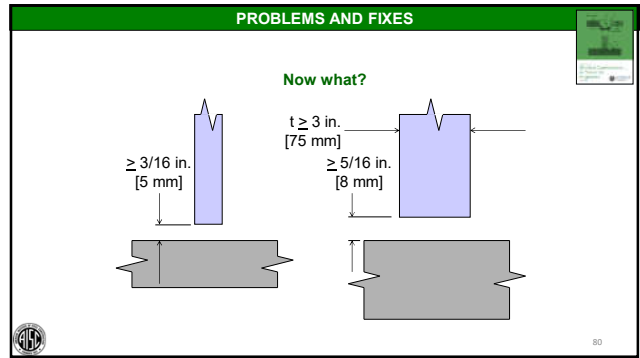
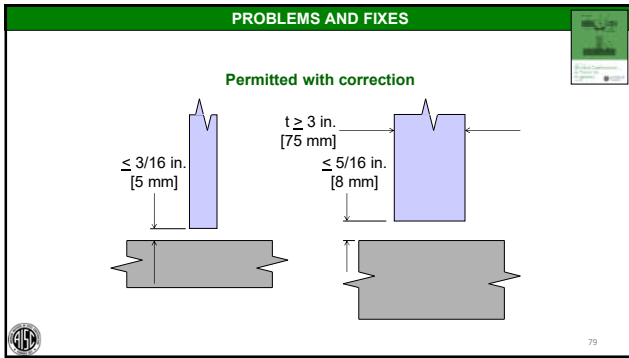








AWS D1.1:2020 Structural Welding Code--Steel

8.8 Engineer's Approval for Alternate Acceptance Criteria
 The fundamental premise of the code is to provide general stipulations applicable to most situations. Acceptance criteria for production welds different from those described in the code may be used for a particular application, provided they are suitably documented by the proposer and approved by the Engineer.

These alternate acceptance criteria may be based upon evaluation of suitability for service using past experience, experimental evidence or engineering analysis considering material type, service load effects, and environmental factors.

81

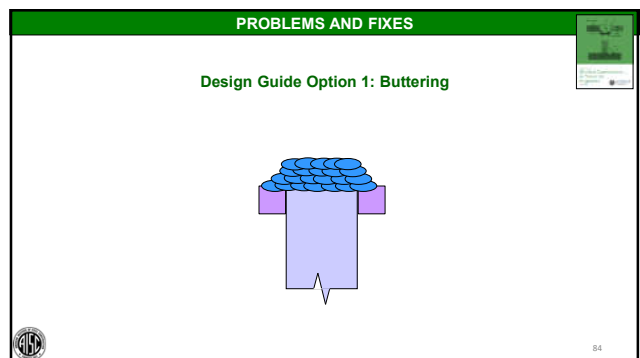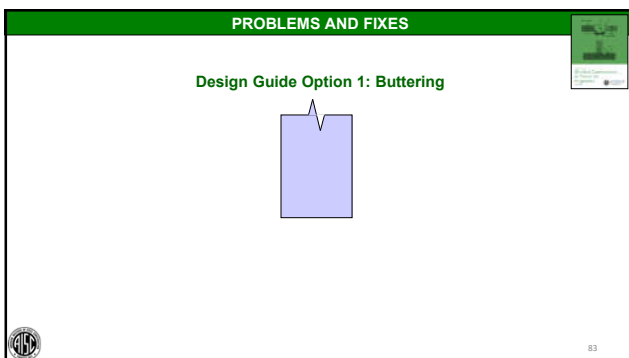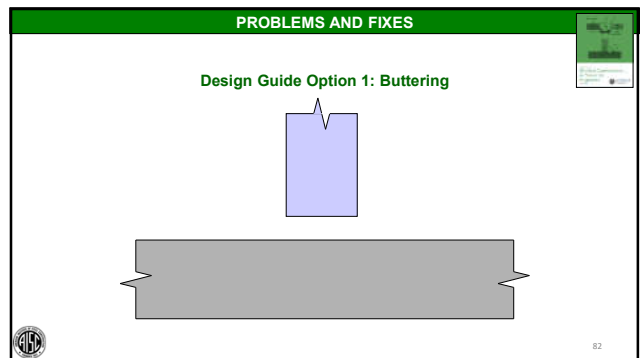

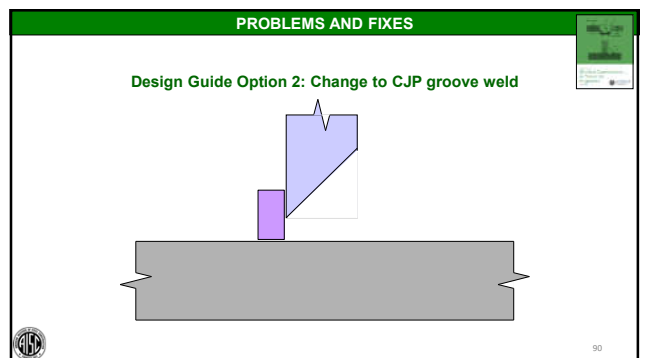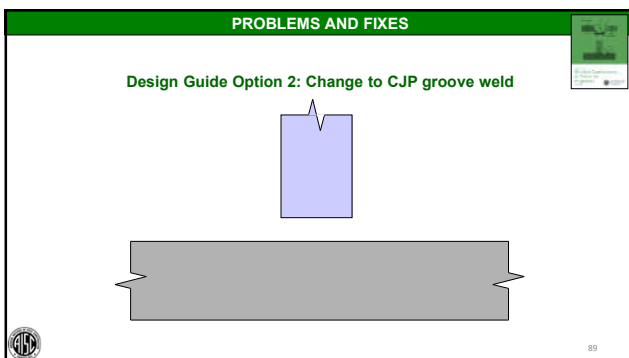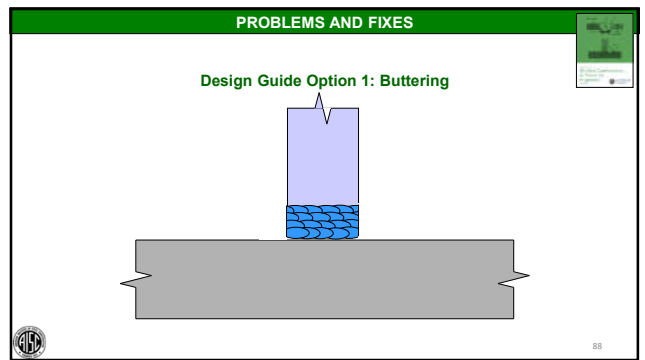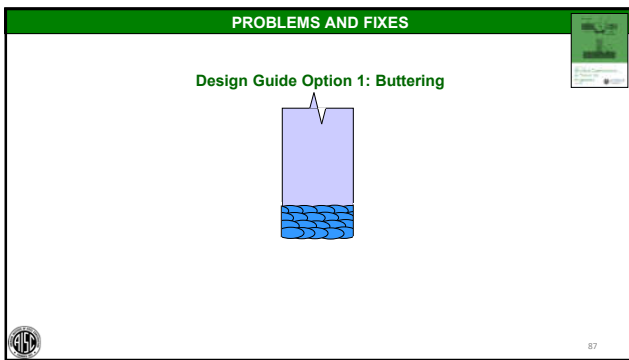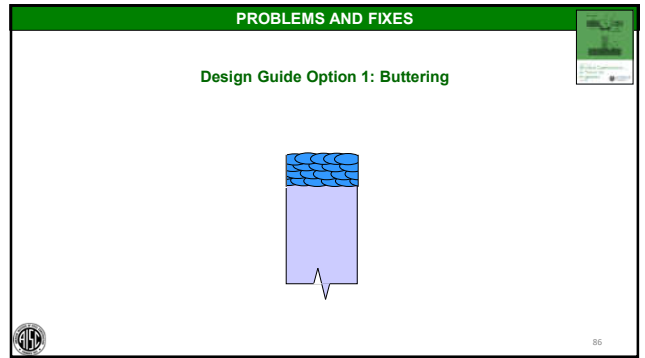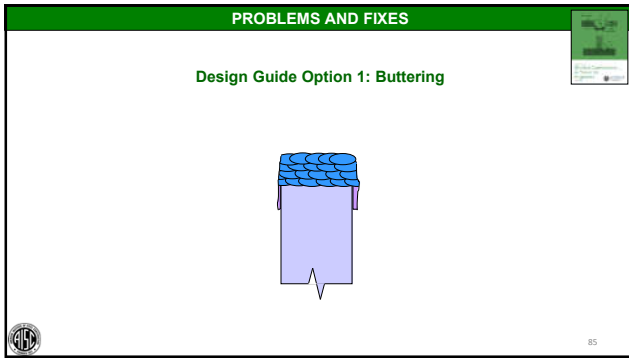

PROBLEMS AND FIXES

15.4 Out-of-tolerance Weld Joints

- 15.4.1 Sources of Fit-Up Variation
- 15.4.2 Fit-Up Problems with Fillet Welded Joints
- ➔ 15.4.3 Fit-Up Problems with CJP Groove Welded Joints
- 15.4.4 Fit-Up Problems with PJP Groove Welded Joints
- 15.4.5 Fit-Up Problems with Plug and Slot Welded Joints

91

PROBLEMS AND FIXES

15.4 Out-of-tolerance Weld Joints

15.4.3 Fit-up Problems with CJP Groove Welded Joints

Prequalified Joint Details		Fitup Problem	
		Too Tight	Too Loose
Backing	Yes	X	X
	No	X	X

92

PROBLEMS AND FIXES

15.4 Out-of-tolerance Weld Joints

15.4.3 Fit-up Problems with CJP Groove Welded Joints

Prequalified Joint Details		Fitup Problem	
		Too Tight	Too Loose
Backing	Yes	X	X
	No	X	X

93

PROBLEMS AND FIXES

15.4 Out-of-tolerance Weld Joints

15.4.3 Fit-up Problems with CJP Groove Welded Joints

Prequalified Joint Details		Fitup Problem	
		Too Tight	Too Loose
Backing	Yes	X	X
	No	X	X

94

PROBLEMS AND FIXES

15.4 Out-of-tolerance Weld Joints

15.4.3 Fit-up Problems with CJP Groove Welded Joints

Prequalified Joint Details		Fitup Problem	
		Too Tight	Too Loose
Backing	Yes	X	X
	No	X	X

95





PROBLEMS AND FIXES

Ideal

Weld volume:
 3.08 lb/ft
 [4.58 kg/m]

$V = 1.0$


96

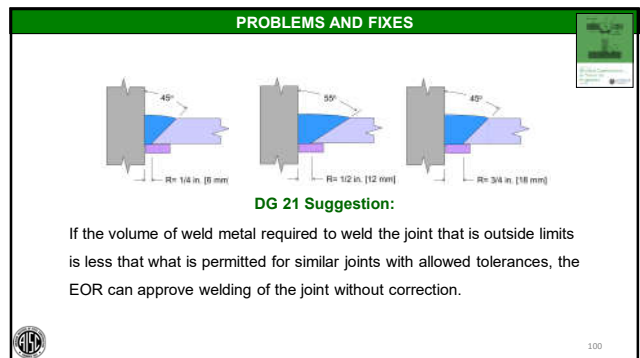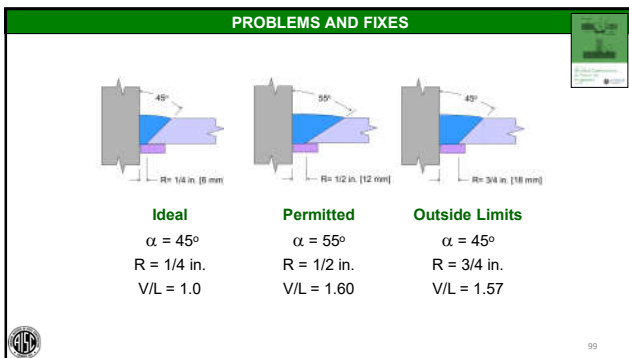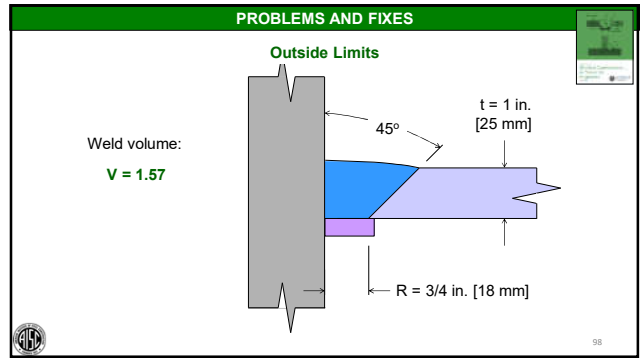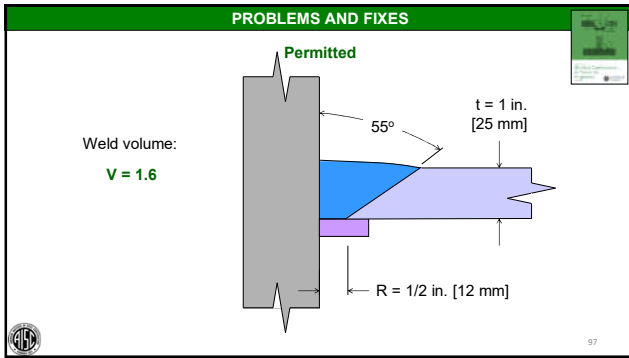

AWS D1.1:2020 Structural Welding Code--Steel

7.21.4.2 Correction.

Root openings greater than those allowed in 7.21.4.1, but not greater than twice the thickness of the thinner part or 3/4 in [20 mm], whichever is less, may be corrected by welding to acceptable dimensions prior to joining the parts by welding.

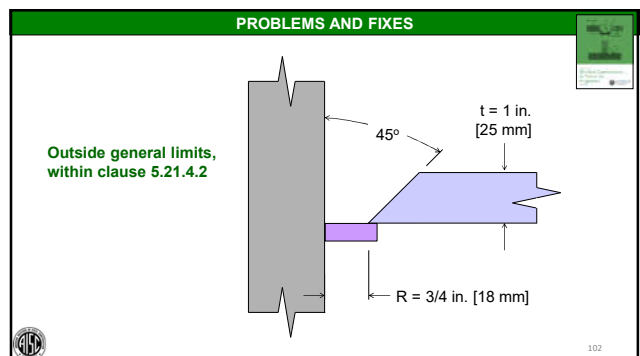

PROBLEMS AND FIXES

Outside general limits, within clause 5.21.4.2

A schematic diagram of a butt joint between two plates. The weld metal is shown in blue. There is a significant gap (root opening) at the bottom of the joint.

103

PROBLEMS AND FIXES

Outside general limits, within clause 5.21.4.2

A schematic diagram of a butt joint similar to slide 103. The root opening is filled with a repair weld, indicated by a different blue shading.

104

PROBLEMS AND FIXES

Outside general limits, within clause 5.21.4.2

Permitted correction: does not require EOR approval

A schematic diagram showing a butt joint with a root opening. A repair weld is applied to the opening. A purple rectangular area is shown below the repair weld, possibly representing a backing or a specific repair technique.

105

AWS D1.1:2020 Structural Welding Code--Steel

7.21.4.3 Engineer's Approval.
 Root openings greater than allowed by 7.21.4.2 may be corrected by welding only with the approval of the Engineer.

106

PROBLEMS AND FIXES

Outside general limits, outside limits of clause 5.21.4.2

A schematic diagram of a butt joint with a root opening. The repair weld is shown with specific dimensions: a thickness $t = 1 \text{ in. [25 mm]}$, a 45-degree angle, and a radius $R = 1 \text{ in. [25 mm]}$.







107



PROBLEMS AND FIXES

Outside general limits, outside limits of clause 5.21.4.2

A schematic diagram of a butt joint with a root opening, showing a repair weld.

108

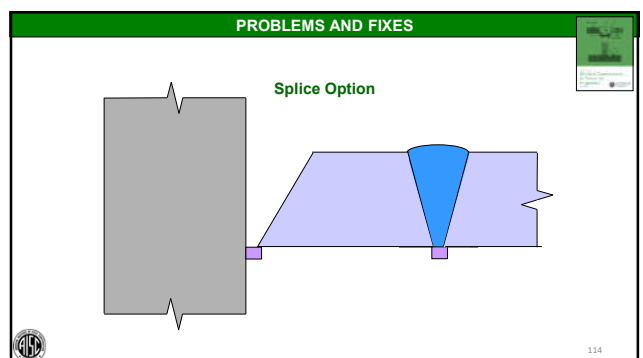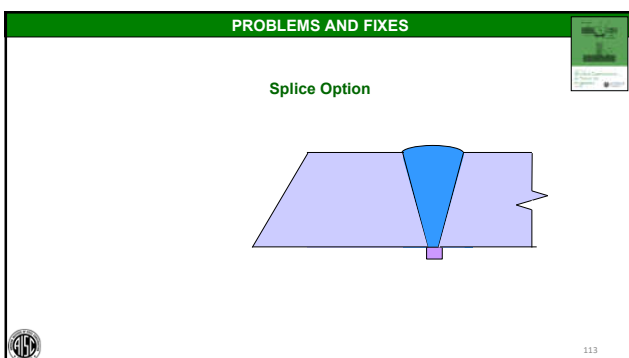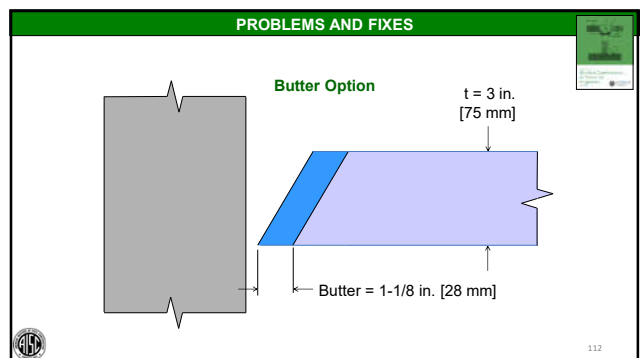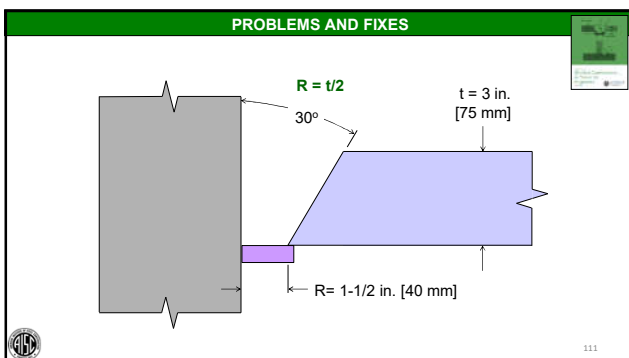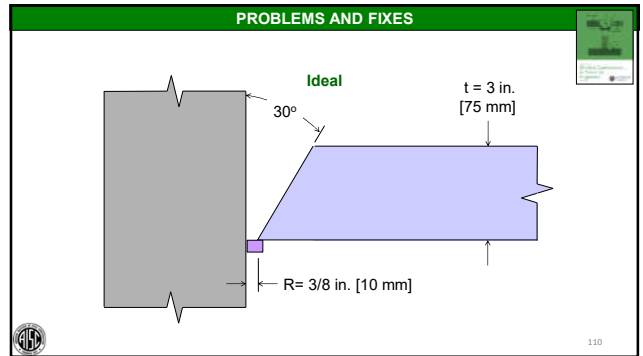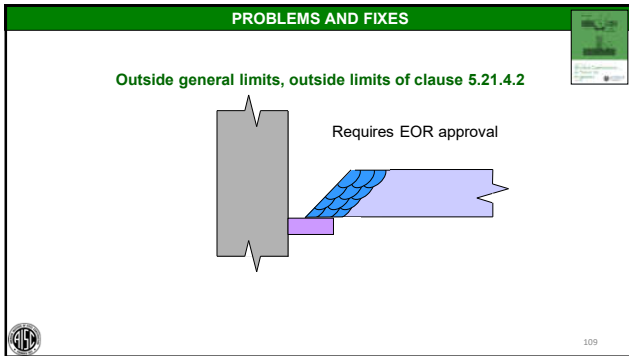

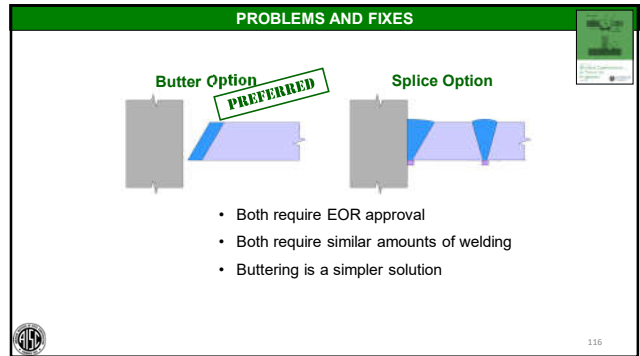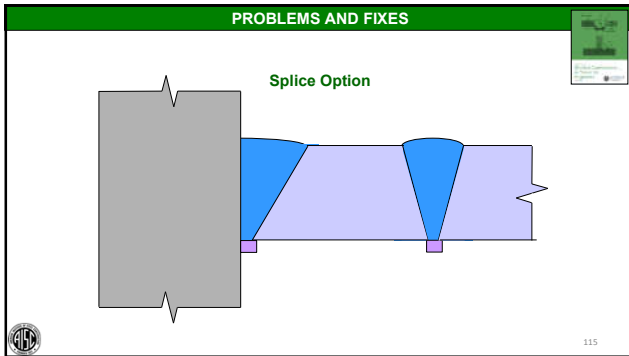



PROBLEMS AND FIXES

15.4 Out-of-tolerance Weld Joints

15.4.3 Fit-up Problems with CJP Groove Welded Joints

Prequalified Joint Details	Fitup Problem		
	Too Tight	Too Loose	
Backing	Yes	X	X
	No	X	X

117





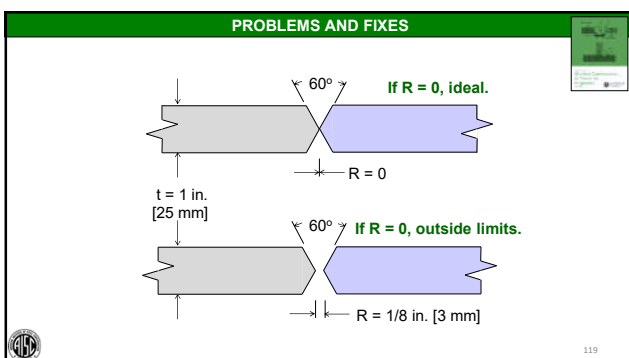
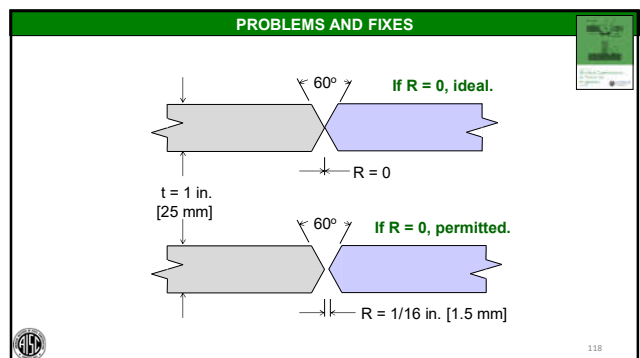








AWS D1.1:2020 Structural Welding Code--Steel

7.21.4.2 Correction.

Root openings greater than those allowed in 7.21.4.1, but not greater than twice the thickness of the thinner part or 3/4 in [20 mm], whichever is less, may be corrected by welding to acceptable dimensions prior to joining the parts by welding.

120

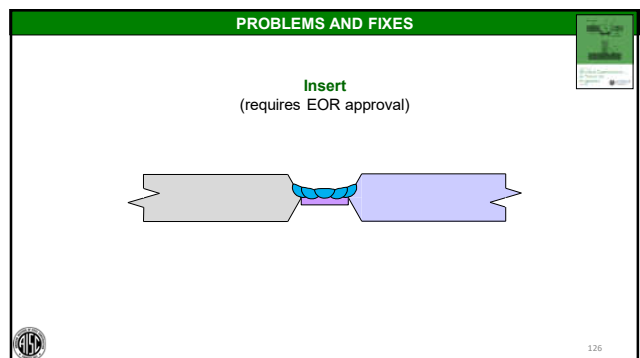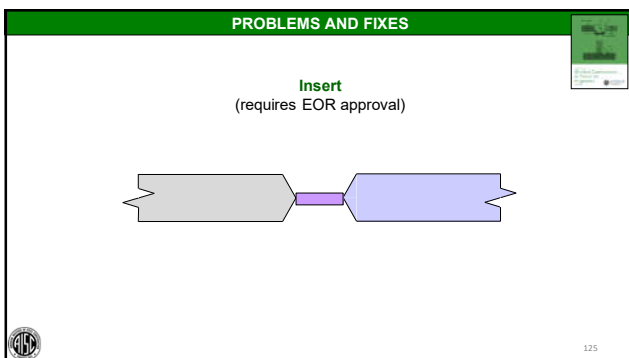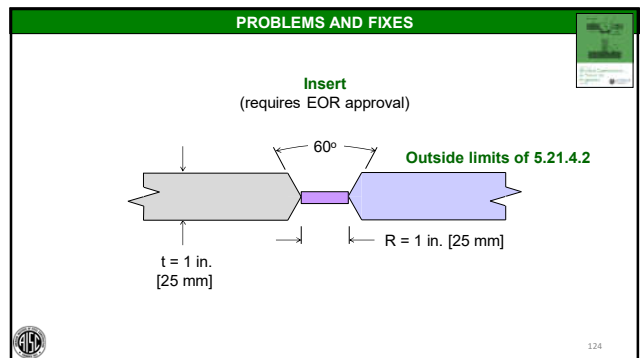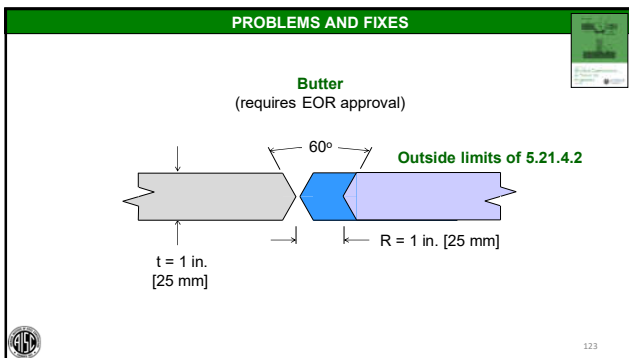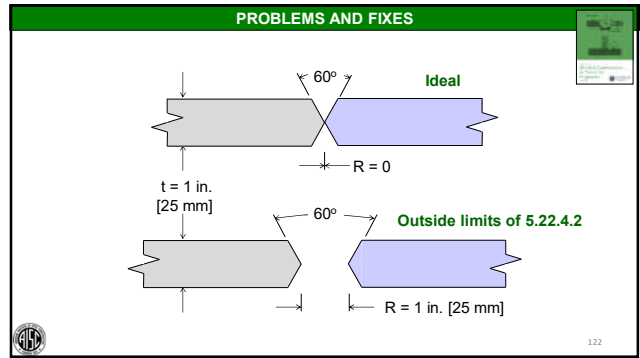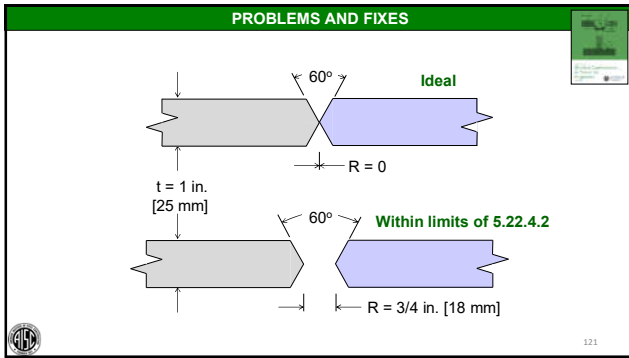

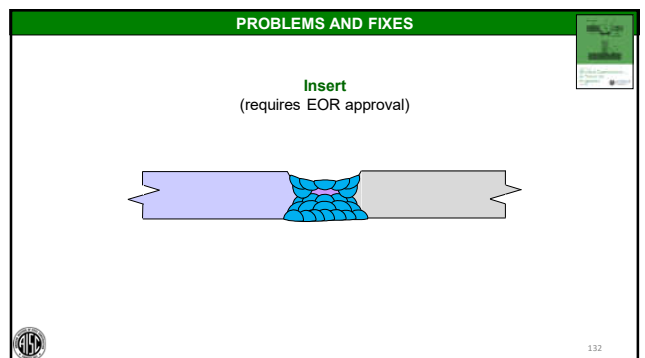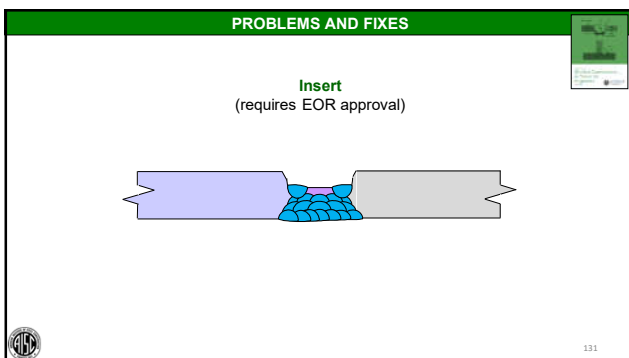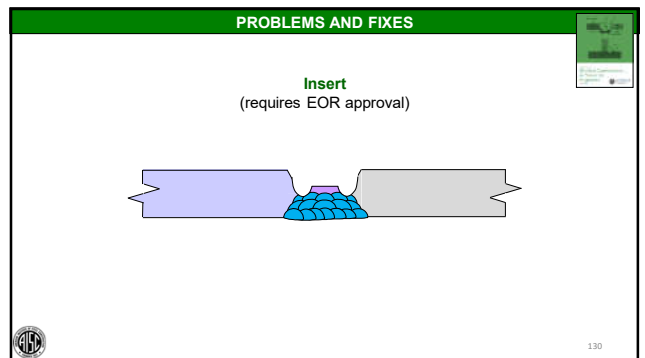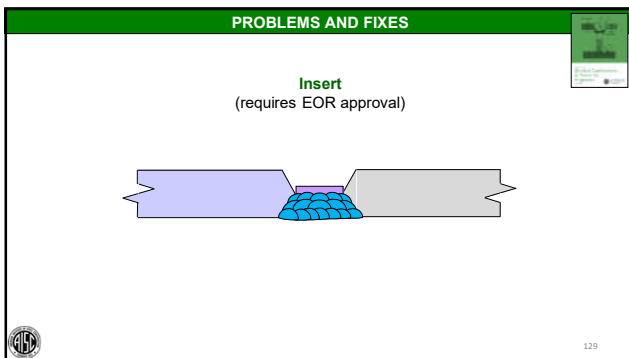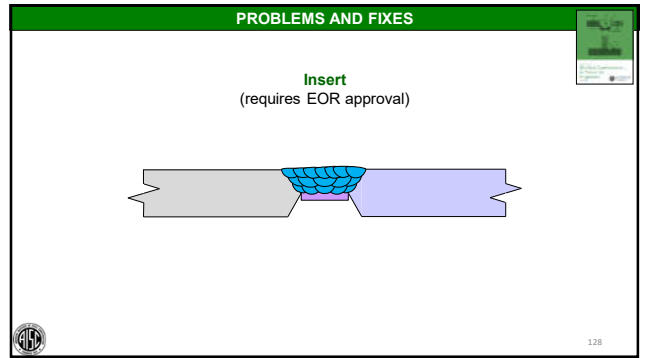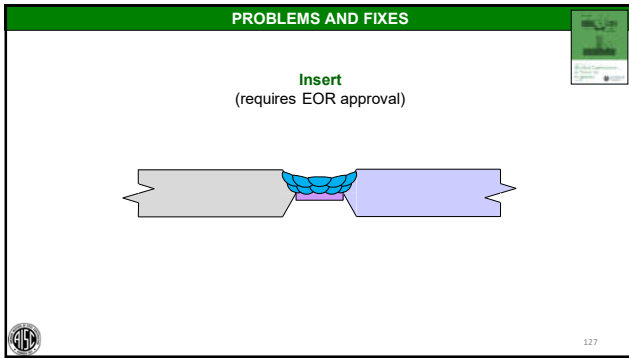

PROBLEMS AND FIXES

Insert
 (requires EOR approval)

133

PROBLEMS AND FIXES

15.4 Out-of-Tolerance Weld Joints: Summary

- The code provides limits, primarily based on workmanship
- The code provides solutions for problems, within limits
- The EOR can extend those limits
- DG21 provides alternatives the EOR can consider

134

PROBLEMS AND FIXES

Chapter 15: Problems and Fixes

- 15.1 Repairs to Base Metal
- 15.2 Repairs to Cut Edges
- 15.3 Butt Joint Alignment
- 15.4 Out-of-Tolerance Weld Joints
- ➔ 15.5 Fixing Members that are Cut Short
- 15.6 Repair of Mislocated Holes
- 15.7 Use of Plug Welds in Lieu of Bolts
- 15.8 Repairs to Welds

135

PROBLEMS AND FIXES

15.5 Fixing Members That Are Cut Short

Buttering may be a good solution

136

PROBLEMS AND FIXES

15.5 Fixing Members That Are Cut Short

Buttering probably not a good solution

137

PROBLEMS AND FIXES

15.5 Fixing Members That Are Cut Short

Use an insert?

138

PROBLEMS AND FIXES

15.5 Fixing Members That Are Cut Short

Gap = 3 - 4 in. [75 - 100 mm]

Use an insert?

139

PROBLEMS AND FIXES

15.5 Fixing Members That Are Cut Short

Gap = 3 - 4 in. [75 - 100 mm]

Use an insert?

140

PROBLEMS AND FIXES

15.5 Fixing Members That Are Cut Short

Gap = 3 - 4 in. [75 - 100 mm]

Install a larger insert

141

PROBLEMS AND FIXES

15.5 Fixing Members That Are Cut Short

DG suggestion: install a larger insert

142

PROBLEMS AND FIXES

15.5 Fixing Members That Are Cut Short

Insert = flange width,
not < 12 in [300 mm]

DG suggestion: install a larger insert

143

AWS D1.1:2020 Structural Welding Code--Steel

7.12 Conformance with Design


The sizes and lengths of welds shall be no less than those specified by design requirements and detail drawings, except as allowed in Table 8.1 or Table 10.16. The location of welds shall not be changed without approval of the Engineer.

144

PROBLEMS AND FIXES

15.5 Fixing Members that are Cut Short

- Buttering may be an option (EOR must approve)
- Using an insert may be an option (EOR must approve)
- DG21 advise: make insert flange width or 12 in [300 mm] minimum to separate the two parallel welds



145


PROBLEMS AND FIXES

Chapter 15: Problems and Fixes

- 15.1 Repairs to Base Metal
- 15.2 Repairs to Cut Edges
- 15.3 Butt Joint Alignment
- 15.4 Out-of-Tolerance Weld Joints
- 15.5 Fixing Members that are Cut Short
- ➔ 15.6 Repair of Mislocated Holes
- 15.7 Use of Plug Welds in Lieu of Bolts
- 15.8 Repairs to Welds



146

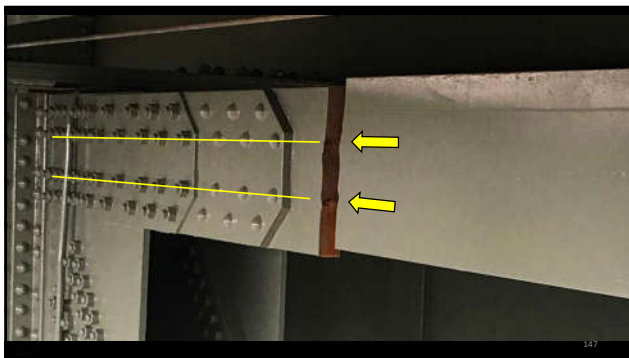


AWS D1.1:2020 Structural Welding Code--Steel

7.25.5 Welded Restoration of Base Metal with Mislocated Holes.

Mislocated holes may be left open or filled with bolts except when welding is necessary to fulfill contract requirements or when require by the engineer. Base metal with mislocated holes may be restored by welding provided the Contractor prepares and follows a qualified or prequalified WPS and meeting the requirements of (1) through (4) below. The geometry shall be considered prequalified.

-




148

AWS D1.1:2020 Structural Welding Code--Steel

C-7.25.5 Welded Restoration of Base Metal with Mislocated Holes.

The following may be found useful when addressing mislocated holes:


(two approaches follow)









149







PROBLEMS AND FIXES







First approach



150

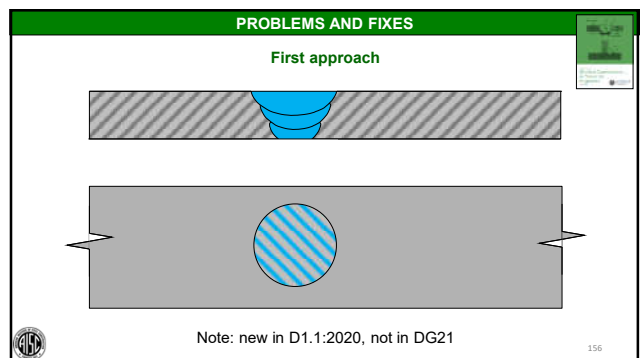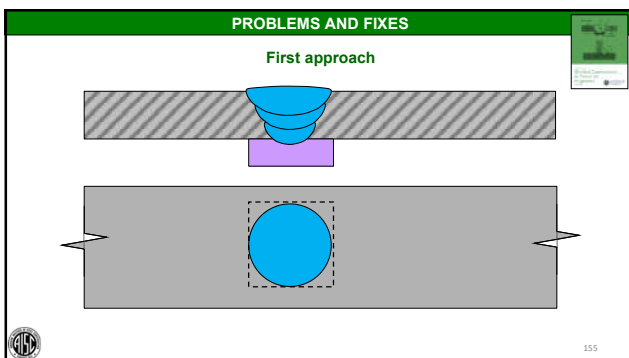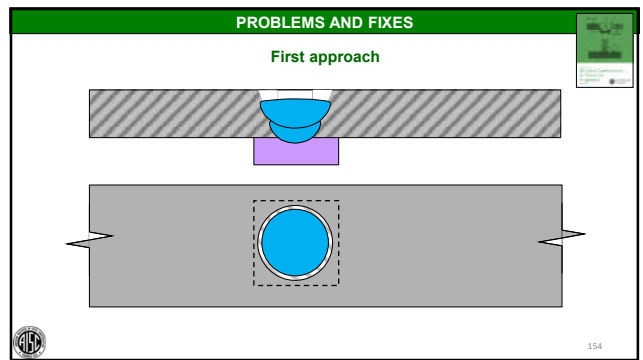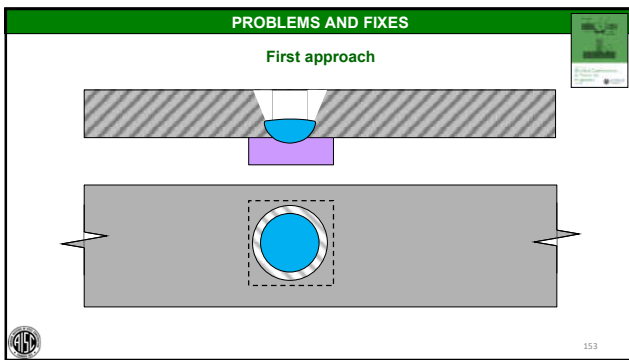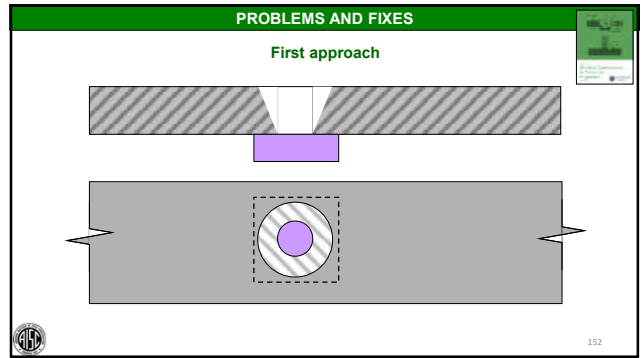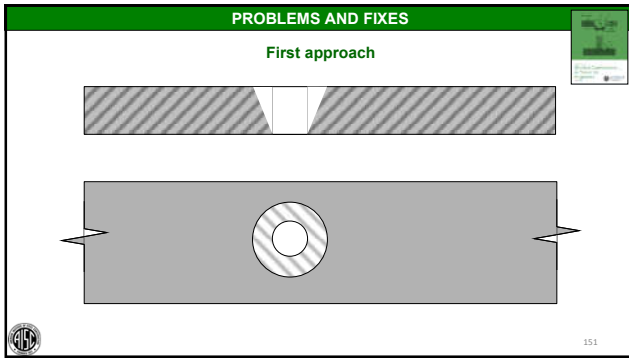

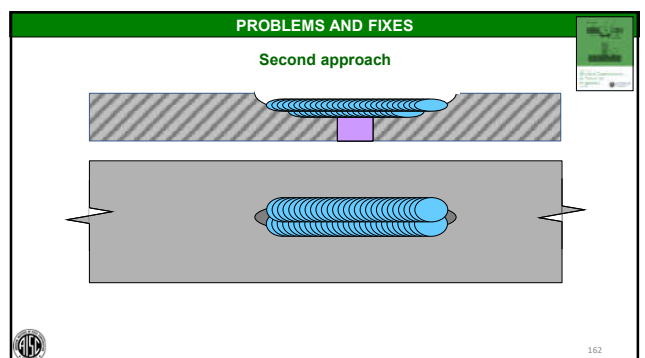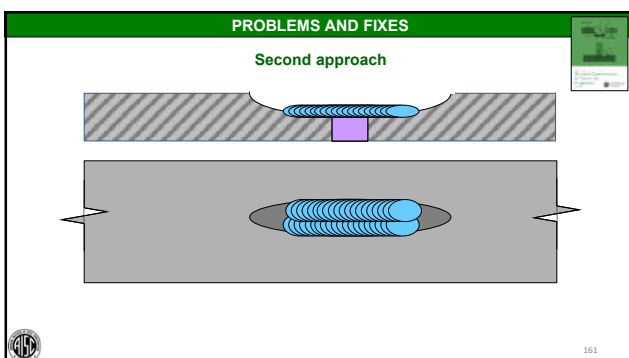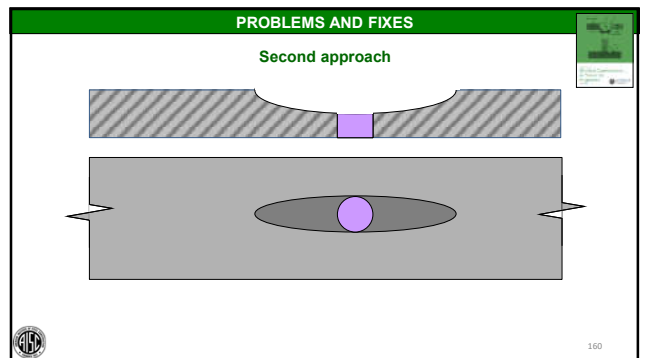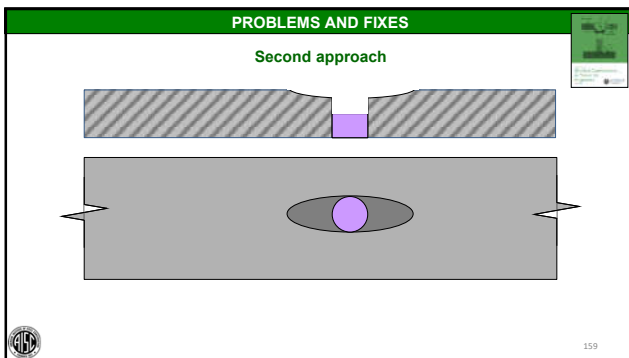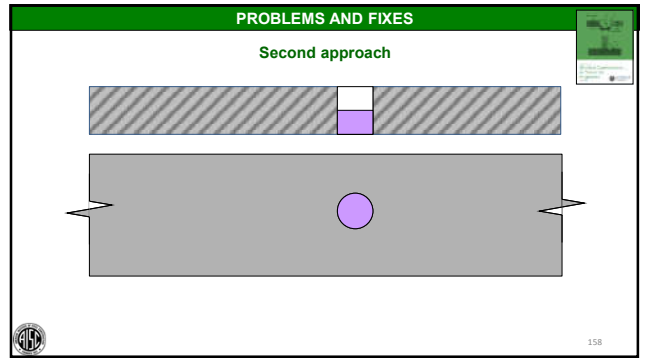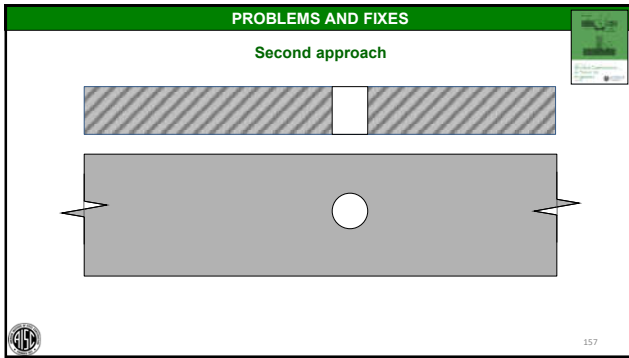

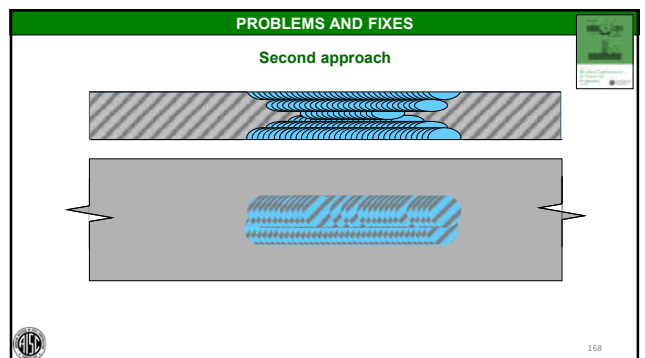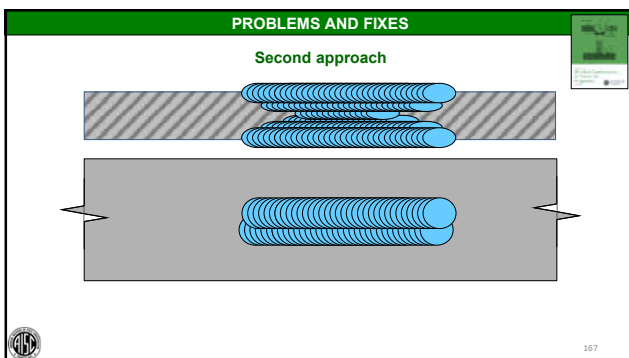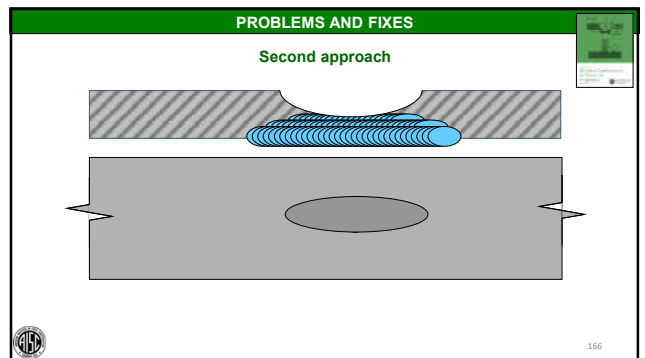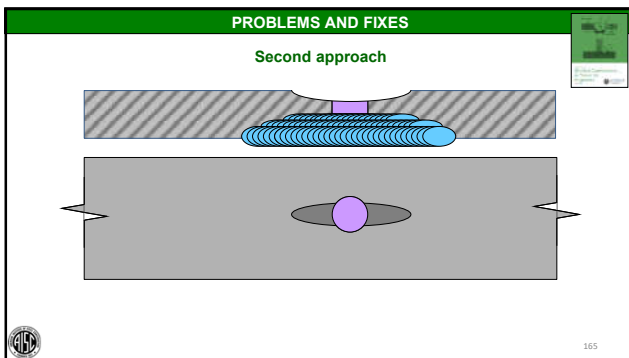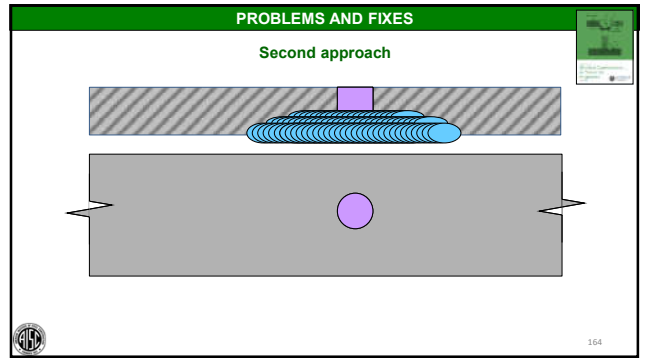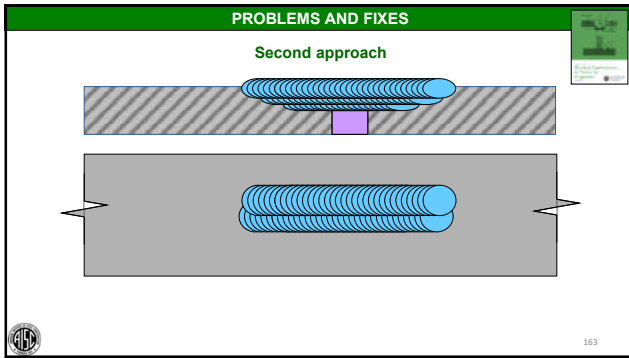


AWS D1.1:2020 Structural Welding Code--Steel

7.25.5 Welded Restoration of Base Metal with Mislocated Holes.

Mislocated holes may be left open or filled with bolts except when welding is necessary to fulfill contract requirements or when require by the engineer. Base metal with mislocated holes may be restored by welding provided the Contractor prepares and follows a qualified or prequalified WPS and meeting the requirements of (1) through (4) below. The geometry shall be considered prequalified.

•




169

PROBLEMS AND FIXES

15.6 Repair of Mislocated Holes: Summary

- Caution: improperly repaired holes have been a problem, particularly for cyclically loaded structures
- Leaving the hole unfilled, or inserting a bolt, are good options
- If a weld repair is required, carefully follow code requirements and commentary recommendations



170

PROBLEMS AND FIXES

Chapter 15: Problems and Fixes



- 15.1 Repairs to Base Metal
- 15.2 Repairs to Cut Edges
- 15.3 Butt Joint Alignment
- 15.4 Out-of-Tolerance Weld Joints
- 15.5 Fixing Members that are Cut Short
- 15.6 Repair of Mislocated Holes
- ➔ 15.7 Use of Plug Welds in Lieu of Bolts
- 15.8 Repairs to Welds



171

PROBLEMS AND FIXES



15.7 Use Of Plug Welds In Lieu Of Bolts

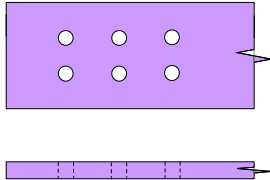172

PROBLEMS AND FIXES



15.7 Use Of Plug Welds In Lieu Of Bolts

173

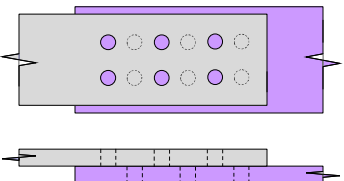PROBLEMS AND FIXES

15.7 Use Of Plug Welds In Lieu Of Bolts



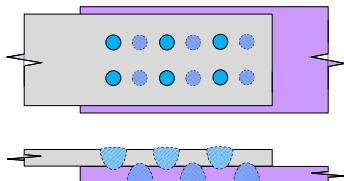

174

PROBLEMS AND FIXES

Concerns with plug welds



- Original hole was not optimized for plug welding
- Plug weld does not have the capacity of a high strength bolt
- Welding position must be considered; only flat position plug welds are easily made
- For cyclically loaded connections, plug welds have poor fatigue performance (Category E, F)
- Plug welds are assumed to be loaded in shear
- Bolted connection limit states may be different than plug welded connection limit states



175

PROBLEMS AND FIXES



Drill new holes and install more bolts

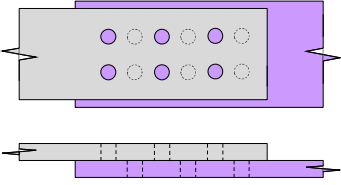176

PROBLEMS AND FIXES



Drill new holes and install more bolts

177

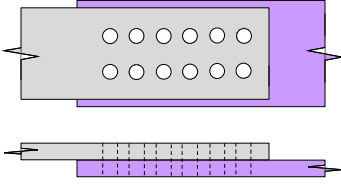PROBLEMS AND FIXES



Drill new holes and install more bolts

178

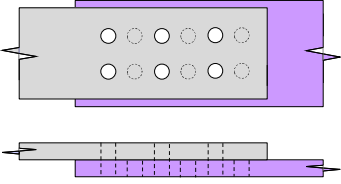PROBLEMS AND FIXES



Weld hole and re-drill







179






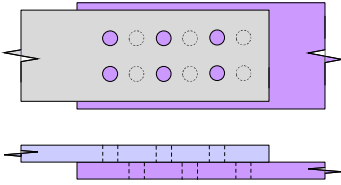
PROBLEMS AND FIXES

Weld hole and re-drill

180

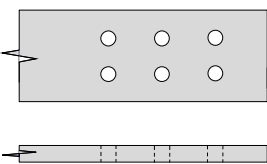

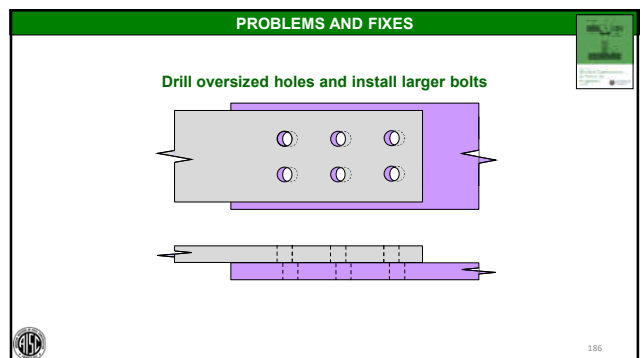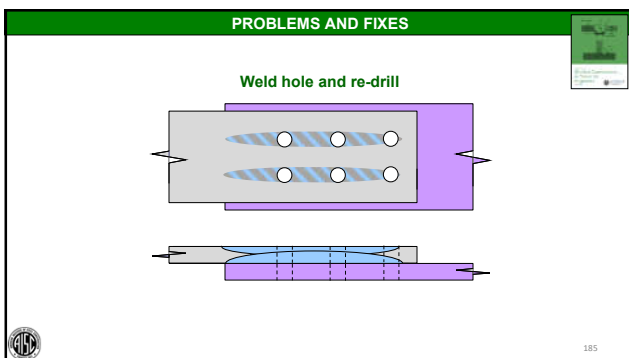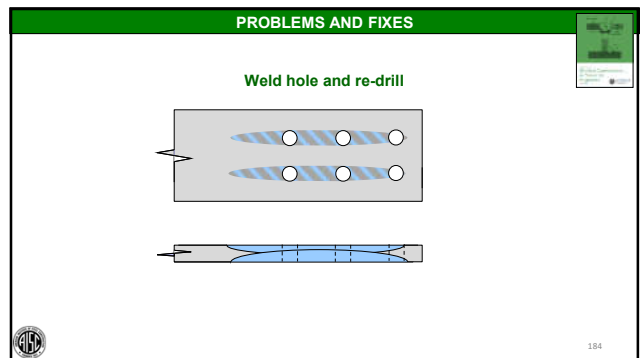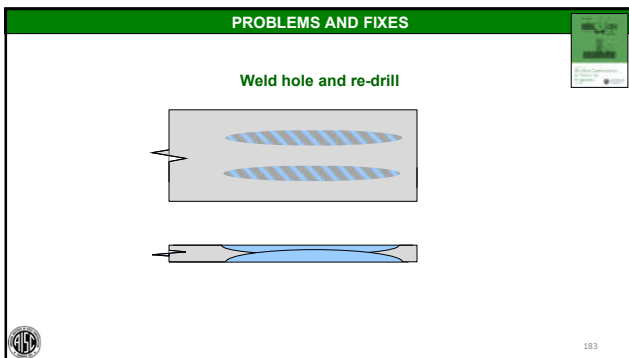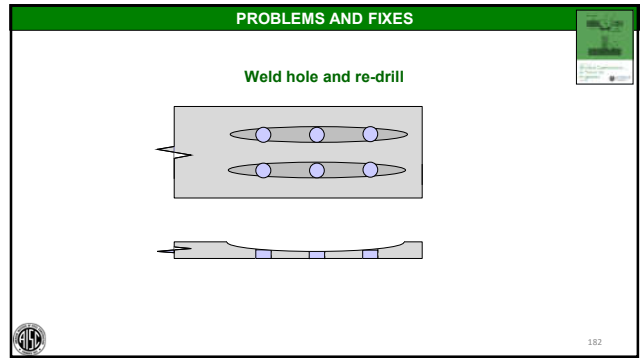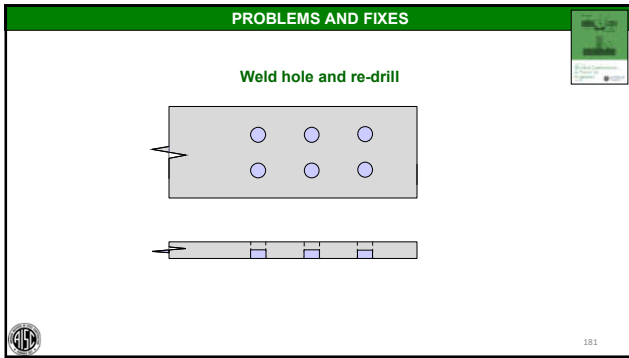

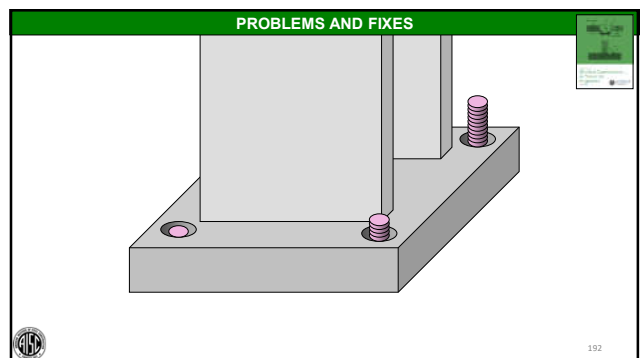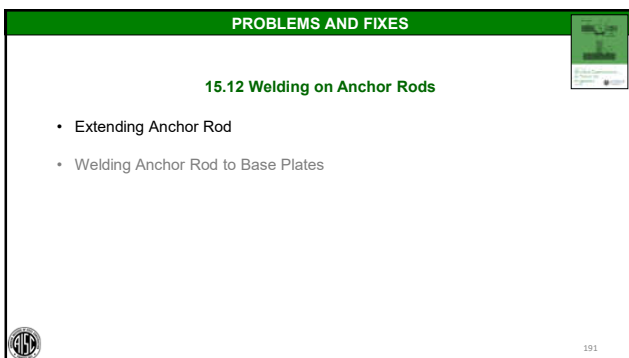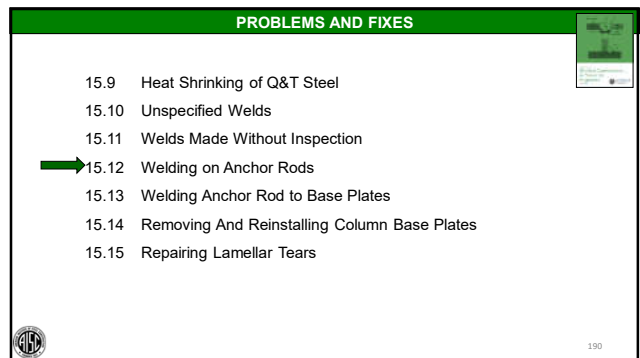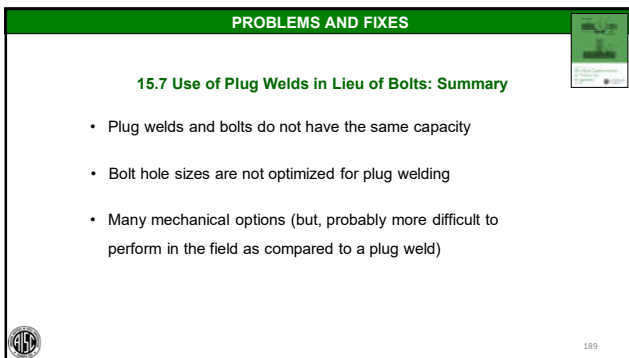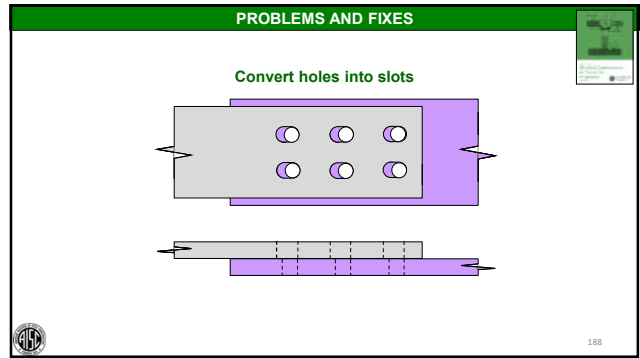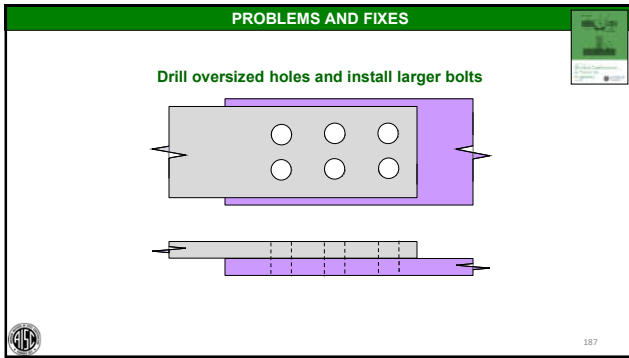PROBLEMS AND FIXES

Extending Anchor Rods

- Secure the column
- Investigate mechanical options
- Investigate weldability

193

AWS STANDARD WELDING TERMS & DEFINITIONS (A3.0:2020)

weldability.
 The relative ease with which a material may be welded to meet an applicable standard

194

PROBLEMS AND FIXES

Weldability

- Based on composition
- Driven by carbon content
- Compounded by alloy content
- Related to "hardenability"
- "Hot cracking" concerns as well (S, P, others)

Remember: weldability is not whether the material can be welded, but rather how easily can the material be welded.

195


PROBLEMS AND FIXES

Weldability Concerns With Anchor Rod Specifications

- High Carbon
- High Alloy
- Undefined Carbon, Alloy
- Heat Treatment (Q&T)

196

ASTM A1554-97a
 Standard Specification for Anchor Bolts, Steel, 36, 55, and 105-ksi Yield Strength



197

ASTM A1554-97a
 Standard Specification for Anchor Bolts, Steel, 36, 55, and 105-ksi Yield Strength

4. Classification

Three Grades

4.1 The anchor bolts are furnished in three grades denoting minimum yield strength and two classes denoting thread class as follows:

Grade	Tensile Strength, ksi (MPa)	Description Yield Strength, min. ksi (MPa)	Size Range, in. (mm)
36 ^a	58-80 (400-558)	36 (248)	1/4-4 (6.4-102)
55	75-95 (517-655)	55 (380)	1/4-4 (6.4-102)
105	125-150 (862-1034)	105 (724)	1/4-3 (6.4-76)


Class
 1A anchor bolts with Class 1A threads
 2A anchor bolts with Class 2A threads

^a When Grade 36 is specified, a weldable Grade 55 may be furnished at the supplier's option.

198

ASTM A1554-97a
 Standard Specification for Anchor Bolts, Steel, 36, 55, and 105-ksi Yield Strength

4.2 Weldable steel for Grade 55 is provided for in Supplementary Requirement S1.



199

ASTM A1554-97a
 Standard Specification for Anchor Bolts, Steel, 36, 55, and 105-ksi Yield Strength

Substitution option: weldable Grade 55 for Grade 36


4. Classification

4.1 The anchor bolts are furnished in three grades denoting minimum yield strength and two classes denoting thread class as follows:

Grade	Tensile Strength, ksi (MPa)	Description Yield Strength, min. ksi (MPa)	Size Range, in. (mm)
36 ^A	58-80 (400-558)	36 (248)	1/4-4 (6.4-102)
55	75-95 (517-655)	55 (380)	1/4-4 (6.4-102)
105	125-150 (862-1034)	105 (724)	1/4-3 (6.4-76)

Class
 1A anchor bolts with Class 1A threads
 2A anchor bolts with Class 2A threads


^A When Grade 36 is specified, a weldable Grade 55 may be furnished at the supplier's option.



200

ASTM A1554-97a
 Standard Specification for Anchor Bolts, Steel, 36, 55, and 105-ksi Yield Strength


Permitted Options	
Ordered	Delivered
Grade 36	Grade 36
	Grade 55 S1
Grade 55	Grade 55
	Grade 55 S1
Grade 55 S1	Grade 55 S1
Grade 105	Grade 105



ASTM A1554-97a
 Standard Specification for Anchor Bolts, Steel, 36, 55, and 105-ksi Yield Strength

Permitted Options	
Ordered	Delivered
Grade 36	Grade 36
	Grade 55 S1
Grade 55	Grade 55
	Grade 55 S1
Grade 55 S1	Grade 55 S1
Grade 105	Grade 105

Four Types to be Considered



ASTM A1554-97a
 Standard Specification for Anchor Bolts, Steel, 36, 55, and 105-ksi Yield Strength


Grade 36

TABLE 1 Chemical Requirements for Grade 36

Element	Diameter, in. (mm)		
	To 1/4 (20), incl	Over 1/4 to 1 1/2 (20 to 40), incl	Over 1 1/2 to 4 (40 to 100), incl
Carbon, max. %			
Heat	0.26	0.27	0.28
Product	0.29	0.30	0.31
Manganese, %			
Heat	0.40	0.50	0.60-0.90
Product	0.54-0.98	0.54-0.98	0.54-0.98
Phosphorus, max. %			
Heat	0.04	0.04	0.04
Product	0.05	0.05	0.05
Sulfur, max. %			
Heat	0.05	0.05	0.05
Product	0.06	0.06	0.06
Copper, min. % (when specified)			
Heat	0.20	0.20	0.20
Product	0.18	0.18	0.18

^A Optional with the manufacturer but shall be compatible with weldable steel.

Similar to A36




ASTM A1554-97a
 Standard Specification for Anchor Bolts, Steel, 36, 55, and 105-ksi Yield Strength

Grade 55
Grade 105

TABLE 2 Chemical Requirements for Grades 55 and 105

Element	Composition, %	
	Heat Analysis	Product Analysis
Phosphorous, max	0.040	0.048
Sulfur, max	0.050	0.058
Copper, min (when Cu is specified)	0.20	0.18

No controls on carbon or alloy content




ASTM A1554-97a
 Standard Specification for Anchor Bolts, Steel, 36, 55, and 105-ksi Yield Strength

Grade 55 S1

S1. Grade 55 Bars and Anchor Bolts

S1.1 The material described in this section is intended for welding. This supplemental section, by chemical composition restrictions and by a carbon equivalent formula, provides assurance of weldability.

S1.2 Welding technique is of fundamental importance when bolts produced to this supplementary section are welded. It is assumed that suitable welding procedures for the steel being welded and the intended service will be selected.



ASTM A1554-97a
 Standard Specification for Anchor Bolts, Steel, 36, 55, and 105-ksi Yield Strength

Grade 55 S1


S1.5 Chemical Composition:
 S1.5.1 Steel shall conform to the following limitations:

	Heat Analysis	Product Analysis
Carbon, max, %	0.30	0.33
Manganese, max, %	1.35	1.41
Phosphorus, max, %	0.040	0.048
Sulfur, max, %	0.050	0.058
Silicon, max, %	0.50	0.55

→ Carbon, max, %
→ Manganese, max, %
→ Phosphorus, max, %
→ Sulfur, max, %
→ Silicon, max, %

Cold Cracking Controls

Hot Cracking Controls



ASTM A1554-97a
 Standard Specification for Anchor Bolts, Steel, 36, 55, and 105-ksi Yield Strength


Grade 55 S1

S1.5.2 **Carbon Equivalent**—In addition to the requirements specified in S1.5.1, the analysis shall be such as to provide a carbon equivalent (CE) meeting the following requirements:

S1.5.2.1 For alloy or low-alloy steel, the carbon equivalent shall not exceed **1.45%** when calculated as follows:

$$CE = \% C + \frac{\% Mn}{6} + \frac{\% Cu}{40} + \frac{\% Ni}{20} + \frac{\% Cr}{10} + \frac{\% Mo}{30} + \frac{\% V}{10}$$

S1.5.2.2 For carbon steel, the carbon equivalent shall not exceed **0.40%** when calculated as follows:


$$CE = \% C + \frac{\% Mn}{4}$$


Weldability of Anchor Rods

Grade 36

- Chemistry is similar to that of ASTM A36
- Deviation on Mn permitted only for smaller rods
- If Grade 55 is substituted, only weldable (S1) material may be used

Weldability should be good.




Weldability of Anchor Rods

Grade 55

- The only chemistry control is on S, P (and Cu, when Cu is specified)
- No weldability promises

Weldability should be investigated on a case-by-case basis.




209

Weldability of Anchor Rods

Grade 55 S1

- Chemistry is similar to that of ASTM A36
- Carbon equivalency limits
- "The material described in this section is intended for welding."
- "This supplemental section...provides assurance of weldability."

Weldability should be good.



210


Weldability of Anchor Rods

Grade 105

- The only chemistry control is on S, P (and Cu, when Cu is specified)
- No weldability promises
- High strength (105 ksi yield)
- May be quenched and tempered

Weldability is likely to be poor.

Caveat: poor weldability does not mean unweldable.




211





PROBLEMS AND FIXES







Extending Anchor Rods







- Secure the column
- Investigate mechanical options
- Investigate weldability
- Use an appropriate detail



212

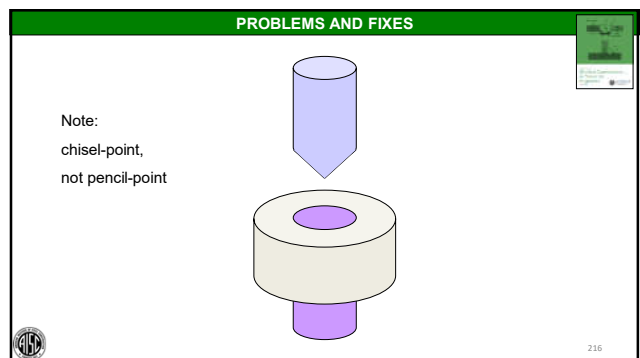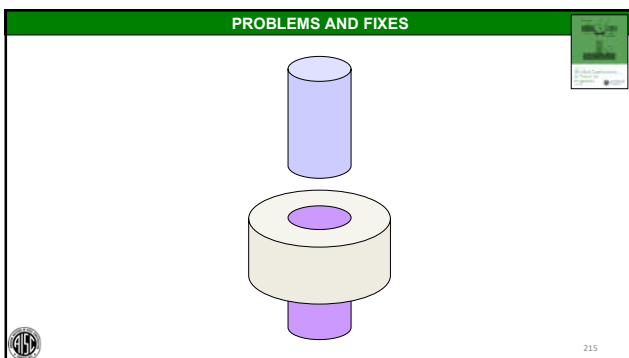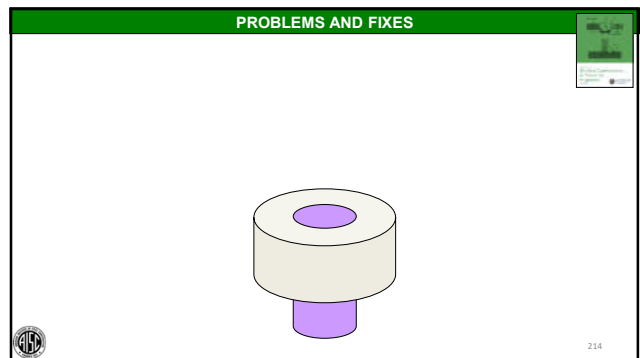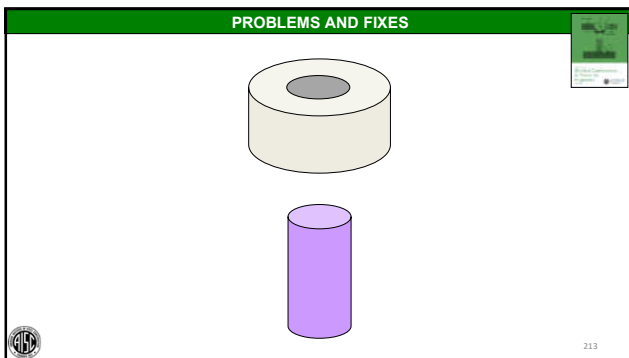

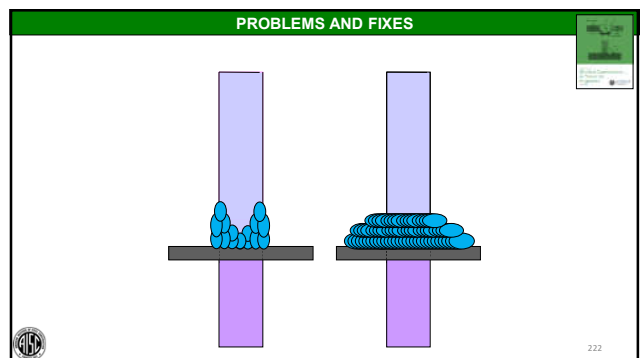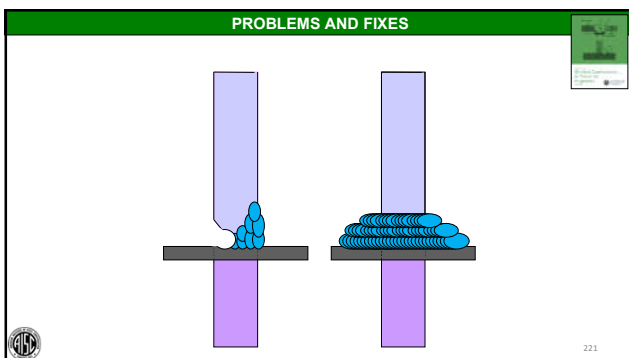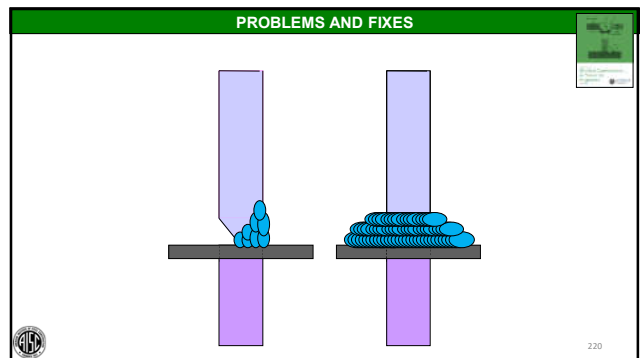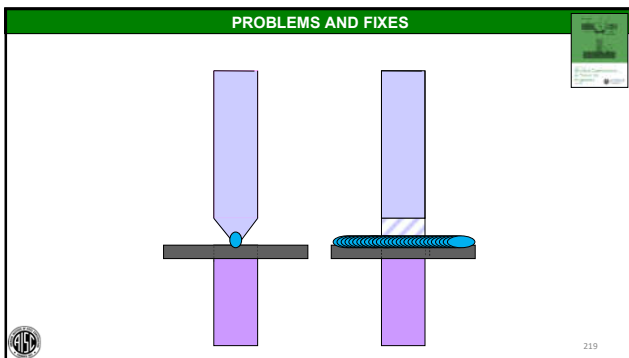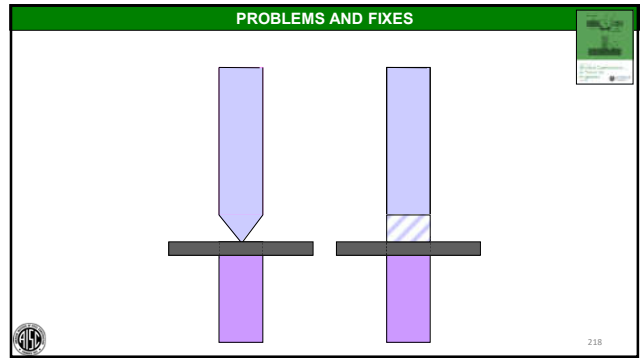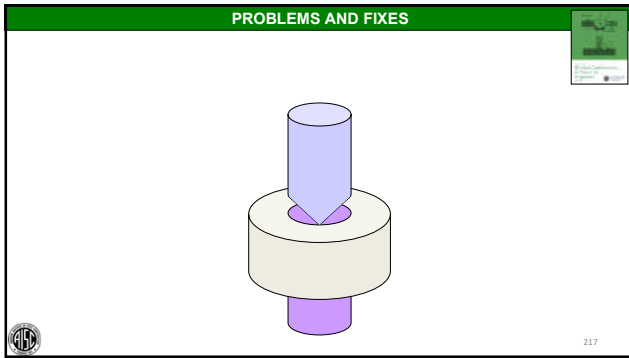

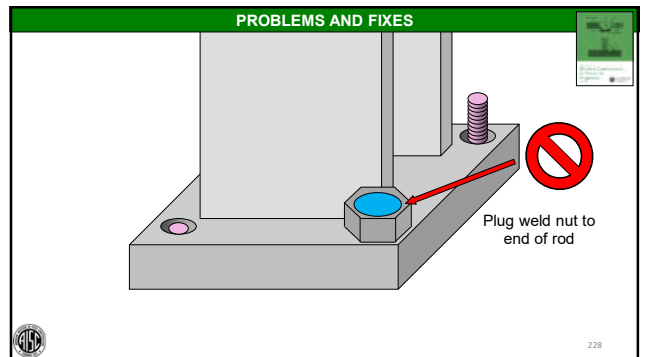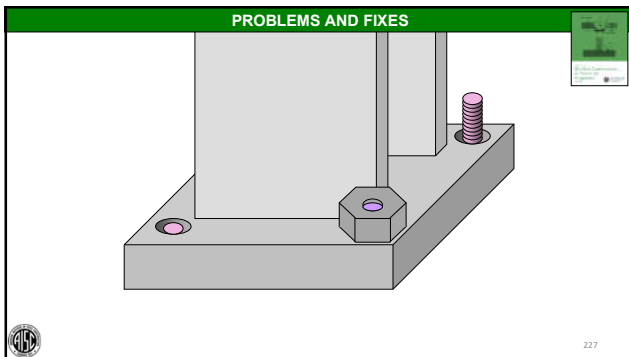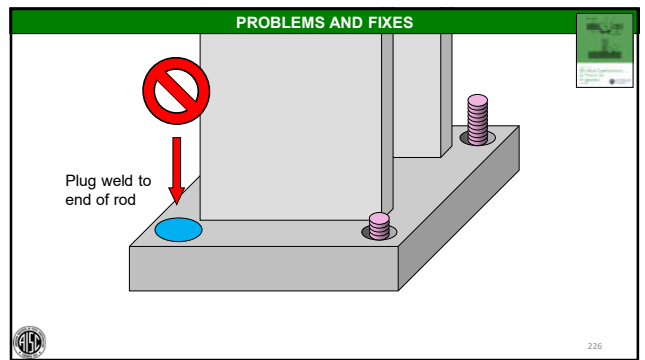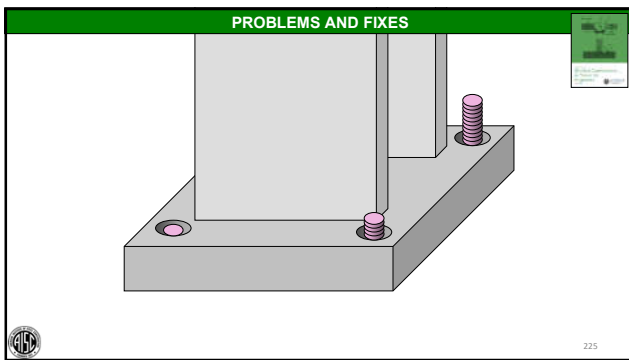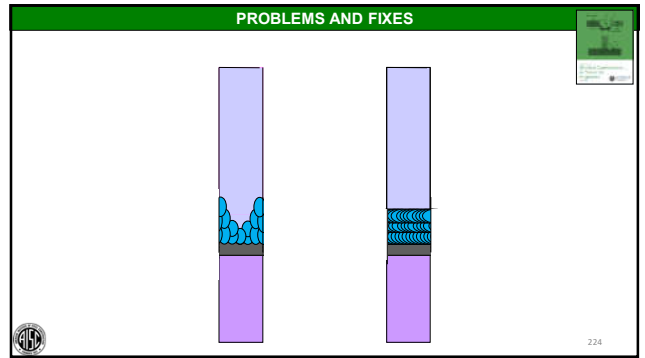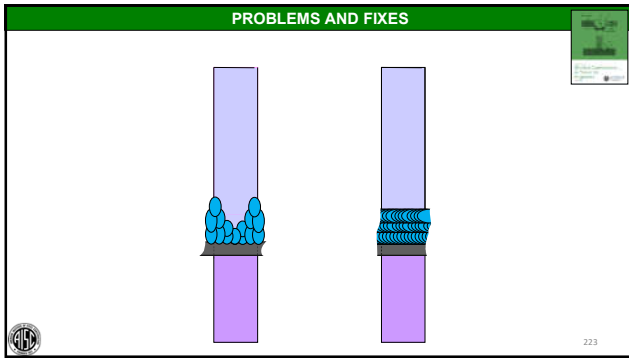




PROBLEMS AND FIXES

15.12 Welding on Anchor Rods

- Extending Anchor Rod
- Welding Anchor Rod to Base Plates



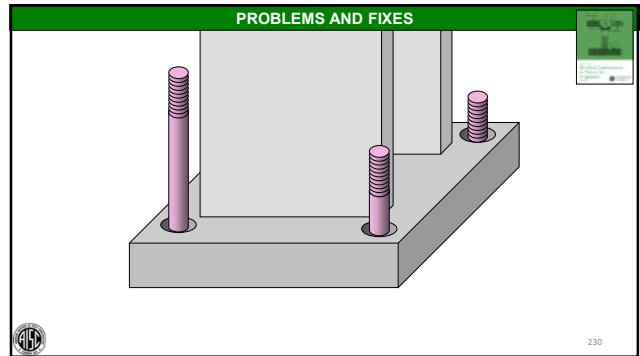

229





PROBLEMS AND FIXES

Welding Anchor Rod to Base Plates

- Secure the column
- Is there sufficient anchorage?
- Investigate mechanical options



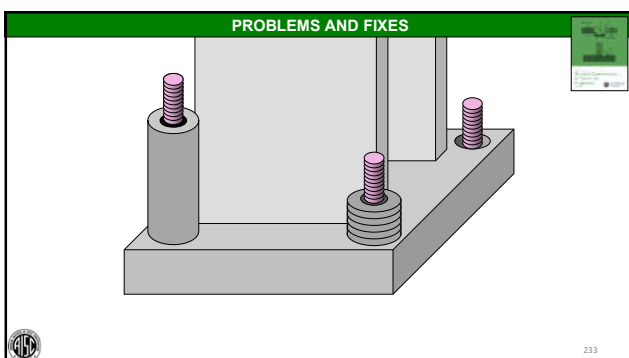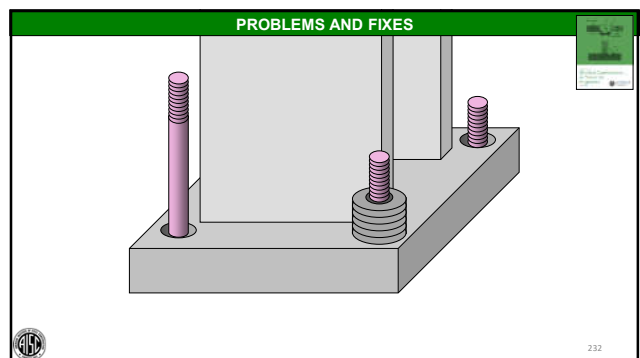

231






PROBLEMS AND FIXES

Welding Anchor Rod to Base Plates

- Secure the column
- Is there sufficient anchorage?
- Investigate mechanical options
- Investigate weldability
- Use an appropriate detail



234

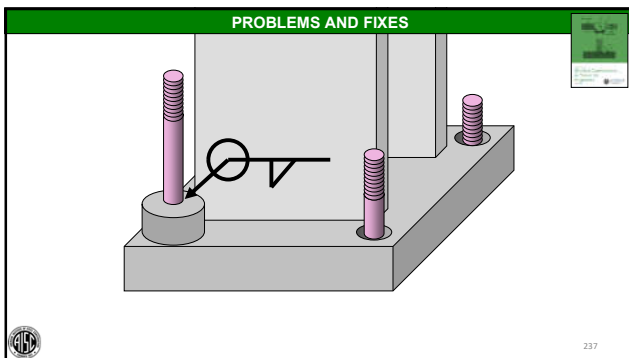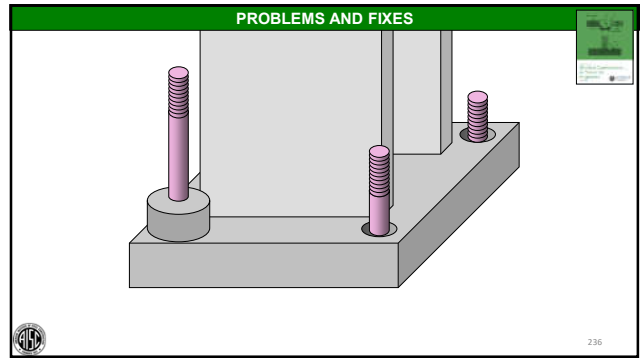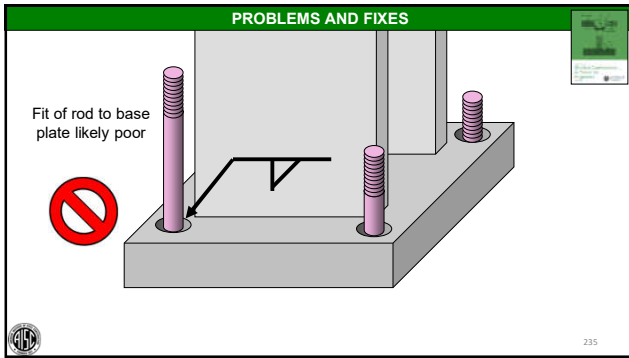

- PROBLEMS AND FIXES
- 15.9 Heat Shrinking of Q&T Steel
 - ➔ 15.10 Unspecified Welds
 - 15.11 Welds Made Without Inspection
 - 15.12 Welding on Anchor Rods
 - 15.13 Welding Anchor Rod to Base Plates
 - 15.14 Removing And Reinstalling Column Base Plates
 - 15.15 Repairing Lamellar Tears
- 238

PROBLEMS AND FIXES

Unspecified Welds

Unspecified welds are welds made on a structure that are not identified on contract, shop, or erection drawings.

Tack welds and construction aid welds are separately discussed in AWS D1.1, clause 7.17, with specific provisions for dealing with each type of weld; these are not categorized as unspecified welds.

239

AWS D1.1:2020 Structural Welding Code--Steel

8.5 Inspection of Work and Records

8.5.1 Size, Length, and Location of Welds.

The Inspector shall ensure that the size, length, and location of all welds conform to the requirements of this code and to the detail drawings and that **no unspecified welds have been added without the approval of the Engineer.**



240

PROBLEMS AND FIXES

Unspecified Welds

The question to be answered: **Why?**

"When it rains, it pours"





241

PROBLEMS AND FIXES

Unspecified Welds

"Additional caution should be given to unspecified welds when the structure is subjected to **cyclic** or **seismic** loading."



"In most cases, problematic unspecified welds can be removed and the localized area repaired by grinding."



242

PROBLEMS AND FIXES

- 15.9 Heat Shrinking of Q&T Steel
- 15.10 Unspecified Welds
- ➔ 15.11 Welds Made Without Inspection
- 15.12 Welding on Anchor Rods
- 15.13 Welding Anchor Rod to Base Plates
- 15.14 Removing And Reinstalling Column Base Plates
- 15.15 Repairing Lamellar Tears






243

PROBLEMS AND FIXES

Question:
The weld was done without the requisite inspection. Do I have it removed and replaced with the inspector present?

A related theoretical question:
Is it possible for a welder to make a good weld if an inspector is not present?





244

AISC 360:16 Specification for Structural Steel Buildings

CHAPTER N

QUALITY CONTROL AND QUALITY ASSURANCE

This chapter addresses **minimum requirements for quality control, quality assurance and nondestructive testing** for structural steel systems and steel elements of composite members for buildings and other structures.





245

AISC 360:16 Specification for Structural Steel Buildings

N5. MINIMUM REQUIREMENTS FOR INSPECTION OF STRUCTURAL STEEL BUILDINGS

4. Inspection of Welding

Observation of welding operations and visual inspection of in-process and completed welds shall be the primary method to confirm that the materials, procedures and workmanship are in conformance with the construction documents.




246

AISC 360:16 Specification for Structural Steel Buildings

N5. MINIMUM REQUIREMENTS FOR INSPECTION OF STRUCTURAL STEEL BUILDINGS

4. Inspection of Welding (cont'd)

As a minimum, welding inspection tasks shall be in accordance with Tables N5.4-1, N5.4-2 and N5.4-3. In these tables, the inspection tasks are as follows:



247


AISC 360:16 Specification for Structural Steel Buildings

N5. MINIMUM REQUIREMENTS FOR INSPECTION OF STRUCTURAL STEEL BUILDINGS

4. Inspection of Welding (cont'd)

(a) Observe (O): **The inspector shall observe these items on a random basis.** Operations need not be delayed pending these inspections.

(b) Perform (P): **These tasks should be performed for each welded joint or member.**



248

AISC 360:16 Specification for Structural Steel Buildings

**TABLE N5.4-1
 Inspection Tasks Prior to Welding**

Inspection Tasks Prior to Welding	QC	QA
Welder qualification records and continuity records	P	O
WPS available	P	P
Manufacturer certifications for welding consumables available	P	P
Material identification (type/grade)	O	O
Welder identification system ^(a)	O	O




249

AISC 360:16 Specification for Structural Steel Buildings

**TABLE N5.4-2
 Inspection Tasks During Welding**

Inspection Tasks During Welding	QC	QA
Control and handling of welding consumables <ul style="list-style-type: none"> • Packaging • Exposure control 	O	O
No welding over cracked tack welds	O	O
Environmental conditions <ul style="list-style-type: none"> • Wind speed within limits • Precipitation and temperature 	O	O



250

AISC 360:16 Specification for Structural Steel Buildings

**TABLE N5.4-3
 Inspection Tasks After Welding**

Inspection Tasks After Welding	QC	QA
Welds cleaned	O	O
Size, length and location of welds	P	P
Welds meet visual acceptance criteria <ul style="list-style-type: none"> • Crack prohibition • Weld/base-metal fusion • Crater cross section • Weld profiles • Weld size • Undercut 	P	P



251

AISC 360:16 Specification for Structural Steel Buildings

**TABLE N5.4-3
 Inspection Tasks After Welding**

Inspection Tasks After Welding	QC	QA
Welds cleaned	O	O
Size, length and location of welds	P	P
Welds meet visual acceptance criteria <ul style="list-style-type: none"> • Crack prohibition • Weld/base-metal fusion • Crater cross section • Weld profiles • Weld size • Undercut • Porosity 	P	P
Are stresses & small?	P	P
Weld access holes in rolled heavy shapes and built-up heavy shapes ^(a)	P	P
Spacing removed and weld rills removed (if required)	P	P
Repair activities	P	P
Document acceptance or rejection of welded joint or member	P	P
No prohibited welds have been joined without the approval of the ECRS	O	O

All of these inspections can still be performed

^(a)When welding of flange plates, web stiffeners or stiffeners has been performed on the flange, visually inspect the web areas for cracks within 1 ft (300 mm) of the weld.
^(b)After welds have been placed, use Section A5.1 for built-up heavy shapes (see Section A5.1.2) and visually inspect the weld access hole for cracks.



252

AISC 360:16 Specification for Structural Steel Buildings

**TABLE N5.4-1
 Inspection Tasks Prior to Welding**

Inspection Tasks Prior to Welding	QC	QA
Welder qualification records and conformity records	P	O
WPS available	P	P
Manufacturer certifications for welding consumables available	P	P
Material identification (typography)	O	O
Welder identification system ⁽¹⁾	O	O
Fit-up of groove welds (including joint geometry)		
• Joint preparation		
• Orientation (alignment, root opening, root face, bevel)	O	O
• Cleanliness (condition of steel surfaces)		
• Backing back weld quality and location		
• Backing type and fit if applicable		
Fit-up of CJP groove welds of 100° V, Y, and K joints without backing (including joint geometry)		
• Joint preparation		
• Orientation (alignment, root opening, root face, bevel)	P	O
• Cleanliness (condition of steel surfaces)		
• Backing back weld quality and location		
• Backing type and fit if applicable		
Configuration and back of access holes	O	O
Fit-up of flat welds		
• Orientation (alignment, gap or root)	O	O
• Cleanliness (condition of steel surfaces)		
• Backing back weld quality and location		
Check welding equipment	O	—

Some of these inspections can still be performed

AISC 360:16 Specification for Structural Steel Buildings

**TABLE N5.4-2
 Inspection Tasks During Welding**

Inspection Tasks During Welding	QC	QA
Control and handling of welding consumables		
• Packaging	O	O
• Exposure control		
No welding over cracked tack welds	O	O
Environmental conditions		
• Wind speed within limits	O	O
• Precipitation and temperature		
WPS followed		
• Settings on welding equipment		
• Travel speed		
• Selected welding materials	P	O
• Shielding gas type/flow rate		
• Preheat applied		
• Interpass temperature maintained (min./max.)		
• Proper position (F, V, H, OH)		
Welding techniques		
• Interpass and final cleaning	O	O
• Each pass within profile limitations		
• Each pass meets quality requirements		
Placement and installation of steel headed stud anchors	P	P

Some of these inspections can still be performed

AISC 360:16 Specification for Structural Steel Buildings

**TABLE N5.4-1
 Inspection Tasks Prior to Welding**

Inspection Tasks Prior to Welding	QC	QA
Welder qualification records and conformity records	P	O
WPS available	P	P
Manufacturer certifications for welding consumables available	P	P
Material identification (typography)	O	O
Welder identification system ⁽¹⁾	O	O
Fit-up of groove welds (including joint geometry)		
• Joint preparation		
• Orientation (alignment, root opening, root face, bevel)	O	O
• Cleanliness (condition of steel surfaces)		
• Backing back weld quality and location		
• Backing type and fit if applicable		
Fit-up of CJP groove welds of 100° V, Y, and K joints without backing (including joint geometry)		
• Joint preparation		
• Orientation (alignment, root opening, root face, bevel)	P	O
• Cleanliness (condition of steel surfaces)		
• Backing back weld quality and location		
• Backing type and fit if applicable		
Configuration and back of access holes	O	O
Fit-up of flat welds		
• Orientation (alignment, gap or root)	O	O
• Cleanliness (condition of steel surfaces)		
• Backing back weld quality and location		
Check welding equipment	O	—

Only two "P" tasks, and those can be done after welding is completed.

AISC 360:16 Specification for Structural Steel Buildings

**TABLE N5.4-2
 Inspection Tasks During Welding**

Inspection Tasks During Welding	QC	QA
Control and handling of welding consumables		
• Packaging	O	O
• Exposure control		
No welding over cracked tack welds	O	O
Environmental conditions		
• Wind speed within limits	O	O
• Precipitation and temperature		
WPS followed		
• Settings on welding equipment		
• Travel speed		
• Selected welding materials	O	O
• Shielding gas type/flow rate		
• Preheat applied		
• Interpass temperature maintained (min./max.)		
• Proper position (F, V, H, OH)		
Welding techniques		
• Interpass and final cleaning	O	O
• Each pass within profile limitations		
• Each pass meets quality requirements		
Placement and installation of steel headed stud anchors	P	P


No "P" tasks (except for studs)

PROBLEMS AND FIXES

Question:
 The weld was done without the requisite inspection. Do I have it removed and replaced with the inspector present?

Questions that should be asked?


- Do the welds meet the visual acceptance criteria?
- Has anything changed?
- Does it pass the smell test?

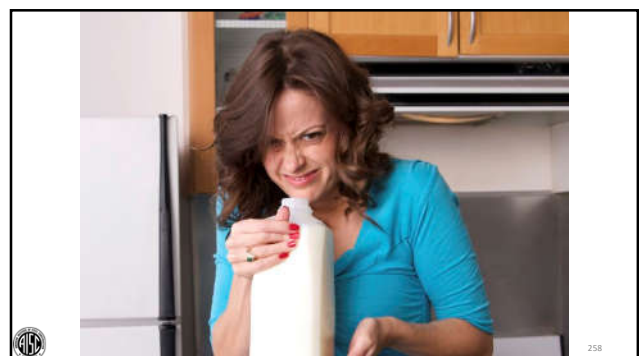

PROBLEMS AND FIXES


Question:
The weld was done without the requisite inspection. Do I have it removed and replaced with the inspector present?

Possible answers:
No, providing a careful review of the situation reveals no significant non-conformances.
Yes, if the review reveals defective welds.



259


PROBLEMS AND FIXES



260

Thank you!

AISC | Questions




Smarter.
Stronger.
Steel.

Individual Session Registrants

PDH Certificates


- All WFH individuals associated with a group registration will be issued a certificate.
- All individuals attending at your connection: you will receive an email on how to report their attendance from: registration@aisc.org.
 - Be on the lookout: Check your spam filter! Check your junk folder!
 - Completely fill out online form. Don't forget to check the boxes next to each attendee's name!



8-Session Registrants

PDH Certificates

One certificate will be issued at the conclusion of all 8 sessions.



8-Session Registrants


Access to the quiz
Information for accessing the quiz will be emailed to you by Wednesday. It will contain a link to access the quiz. EMAIL COMES FROM NIGHTSCHOOL@AISC.ORG.

Quiz and attendance records
Posted Friday mornings. www.aisc.org/nightschool -- Click on Current Course Details.

Reasons for quiz

- EEU – You must take all quizzes and the final exam to receive EEU.
- PDHs – If you watch a recorded session, you must pass quiz for PDHs.
- REINFORCEMENT – Reinforce what you learn tonight. Get more out of the course.

Note: If you attend the live presentation, you do not have to take the quizzes to receive PDHs




8-Session Registrants

Access to the recording

Information for accessing the recording will be emailed to you by Wednesday. The recording will be available for four weeks. (For 8-session registrants only.) EMAIL COMES FROM NIGHTSCHOOL@AISC.ORG

PDHs via recording


If you watch a recorded session, you must take *and pass* the quiz for PDHs.



8-Session Registrants

Night School Resources


Find all your handouts, quizzes and quiz scores, recording access, and attendance information all in one place!



8-Session Registrants

Night School Resources

Go to www.aisc.org and sign in.

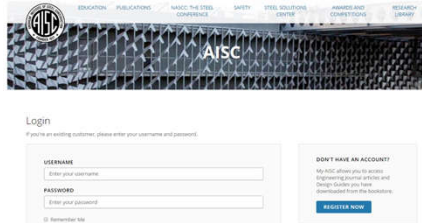


The screenshot shows the AISC website home page with navigation tabs for EDUCATION, PUBLICATIONS, NAVIGATE THE STEEL CONFERENCE, STEEL SOLUTIONS CENTER, ANSWERS AND CONNECTIONS, and RESEARCH LIBRARY. Below the navigation is a 'Login' section with a form for USERNAME and PASSWORD, and a 'DON'T HAVE AN ACCOUNT?' link.

8-Session Registrants

Night School Resources


Go to www.aisc.org and sign in.

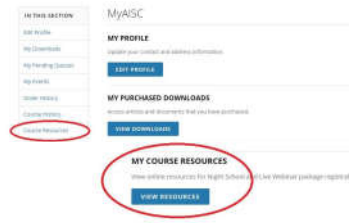

The screenshot shows the 'MyAISC' user profile page. It includes sections for 'MY PROFILE', 'MY PURCHASED DOWNLOADS', and 'MY COURSE RESOURCES'. Red circles highlight the 'MY COURSE RESOURCES' section and the 'MY PURCHASED DOWNLOADS' section.

8-Session Registrants


Night School Resources

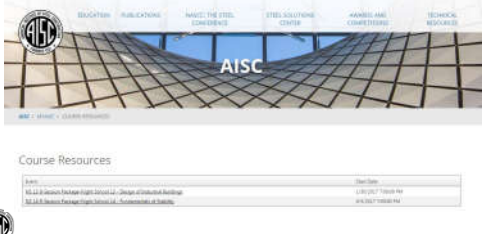

The screenshot shows the 'Course Resources' section of the AISC website. It features a table with columns for 'Event', 'Date', 'Medium', 'Units', and 'Out'. The table lists various courses and their details.

8-Session Registrants

Night School Resources

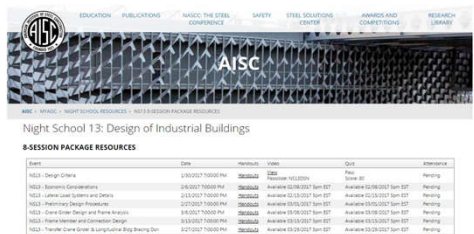

The screenshot shows the 'Night School 13: Design of Industrial Buildings' course details. It includes a table with columns for 'Event', 'Date', 'Medium', 'Units', and 'Out'. The table lists various courses and their details.

Event	Date	Medium	Units	Out	Attendance
NCSL - Design Office	9/30/2017 7:00:00 PM	Web	1.0	Done	None
NCSL - Operations Coordination	9/30/2017 7:00:00 PM	Web	1.0	Available 12/08/2017 Sun EST	None
NCSL - Lateral Load Systems and Details	9/30/2017 7:00:00 PM	Web	1.0	Available 12/08/2017 Sun EST	None
NCSL - Progressive Design Methodology	9/30/2017 7:00:00 PM	Web	1.0	Available 12/08/2017 Sun EST	None
NCSL - Core Wall Design and Frame Analysis	9/30/2017 7:00:00 PM	Web	1.0	Available 12/08/2017 Sun EST	None
NCSL - Open Web Steel and Composite Design	9/30/2017 7:00:00 PM	Web	1.0	Available 12/08/2017 Sun EST	None
NCSL - Transfer Crane Girders & Longitudinal Rig Bracing Design	9/30/2017 7:00:00 PM	Web	1.0	Available 12/08/2017 Sun EST	None
NCSL - Bolting Brackets and Bolting Design	9/30/2017 7:00:00 PM	Web	1.0	Available 12/08/2017 Sun EST	None

8-Session Registrants

Night School Resources

- Weekly “quiz and recording” email.
- Weekly updates of the master quiz and attendance record, found at www.aisc.org/nightschool27. Scroll down to Quiz and Attendance records.
 - Updated on Friday mornings.



8-Session Registrants

Night School Resources

- Webinar connection information
 - Reminder email sent out Monday mornings
- Links to handouts also found here

